

**NEC**

# *OE HYBRID*


*155.52Mbps Transmitter*

**OD-J6500-0B01/HB01**

**OD-J6502-0B01/HB01**

**OC-3: SR, IR-1 and LR-1**

**STM-1: I-1, S-1.1 and L-1.1**

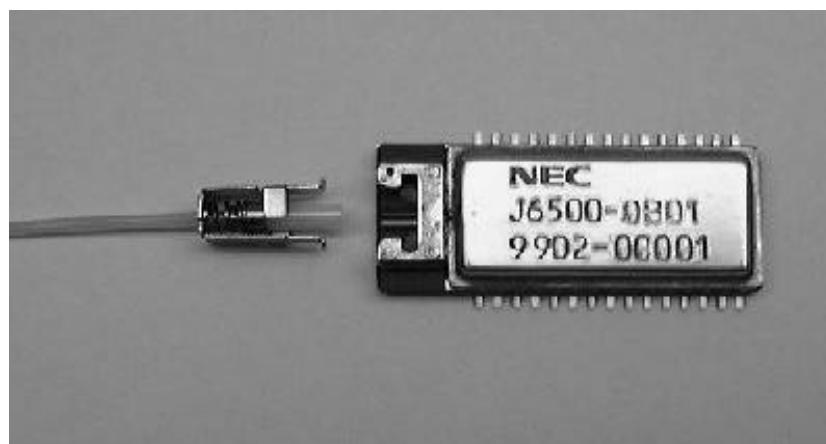



## - Contents -

<b>1. PRODUCT NUMBER .....</b>	<b>3</b>
<b>2. SPECIFICATIONS.....</b>	<b>3</b>
2-1. ABSOLUTE MAXIMUM RATINGS .....	3
2-2. ENVIRONMENTAL CONDITIONS .....	3
2-3. OPTICAL SIGNAL INTERFACE SPECIFICATIONS .....	4
2-4. ELECTRICAL SIGNAL INTERFACE SPECIFICATIONS.....	5
<b>3. FUNCTIONAL BLOCK DIAGRAM.....</b>	<b>7</b>
3-1. FUNCTIONAL BLOCK DIAGRAM.....	7
3-2. ALARM, MONITOR AND CONTROL FUNCTION.....	7
<b>4. RELIABILITY .....</b>	<b>8</b>
4-1. FIT NUMBER .....	8
4-2. RELIABILITY TEST ITEMS AND CONDITIONS .....	8
<b>5. PACKAGE SIZE, PIN ASSIGNMENT .....</b>	<b>9</b>
5-1. OUTLINE DIAGRAM, PIN LAYOUT .....	9
5-2. PIN ASSIGNMENT .....	11
<b>6. RECOMMENDED PERIPHERAL CIRCUIT .....</b>	<b>12</b>
<b>7. PAD LAYOUT.....</b>	<b>13</b>
<b>8. RECOMMENDED PATTERN LAYOUT .....</b>	<b>14</b>
<b>9. TYPICAL OPERATING CHARACTERISTICS.....</b>	<b>15</b>
9-1. OPTICAL OUTPUT WAVEFORM .....	15
<b>10. RECOMMENDED MOUNTING CONDITIONS.....</b>	<b>16</b>
10-1. MOUNT PROHIBITIVE AREA .....	16
10-2. RE-FLOW SOLDERING CONDITIONS.....	16
10-3. SOLVENT CLEANING .....	17
10-4. MOUNTING PRECAUTIONS.....	17
10-5. DE-SOLDERING FROM THE PRINTED BOARD .....	17
10-6. PIGTAIL ATTACHMENT .....	17
10-7. SHIPMENT PACKING.....	19
<b>11. APPLICATION PRECAUTIONS.....</b>	<b>20</b>

## 1. Product Number

<b>Product Number</b>	<b>Specification</b>	<b>Operating Case Temperature Range</b>
OD-J6500-0B01	SONET OC-3 SR and IR-1, ITU-T G. 957 I-1 and S-1.1 compliant	0 to +75 deg.C
OD-J6500-HB01		-40 to +85 deg.C
OD-J6502-0B01	SONET OC-3 LR-1, ITU-T G. 957 L-1.1 compliant	0 to +75 deg.C
OD-J6502-HB01		-40 to +85 deg.C

Pigtail fiber cord is not included with the above products; it has to be separately ordered. The applicable pigtail fiber cords are listed below. Please refer to section 10-6 for connecting a pigtail cord to the above products.

<b>Product Number</b>	<b>Connector Type</b>	<b>Fiber Cord Length</b>
OD-S524-SC-SM	SC	51 to 55 cm
OD-S524-FCPC-SM	FC	
OD-S524-MUJ-SM	MUJ	
OD-S524-MU-SM	MU	

## 2. Specifications

### 2-1. Absolute Maximum Ratings

<b>Parameter</b>	<b>Specification</b>		<b>Unit</b>	<b>Note</b>
	<b>Min</b>	<b>Max</b>		
Supply Voltage (Vcc)	-0.3	+6.0	V	
Storage temperature	-40	+85	deg.C	
Signal Input Pins	0	Vcc	V	

### 2-2. Environmental Conditions

<b>Parameter</b>	<b>Specification</b>	<b>Note</b>
Data Rate	155.52 Mbps	
Data Format	Scrambled NRZ	Scrambler is not included.
Transmission Cable	Single-mode fiber	SI-10/125
Operating Case Temperature Range	0 to +75 deg.C -40 to +85 deg.C	OD-J6500-0B01, OD-J6502-0B01 OD-J6500-HB01, OD-J6502-HB01
Supply Voltage	+3.3V +/-5%	
Power Consumption	0.3 W (Typ) 0.6 W (Max)	Under condition at +25 deg.C, +3.30V Under condition at +85deg.C, +3.47V


## 2-3. Optical Signal Interface Specifications

a) OD-J6500-0B01/HB01

Parameter	Specification		Unit	Note
	Min	Max		
Average Optical Output Power	-15	-8	dBm	
Extinction Ratio	8.2		dB	
RMS Spectral Width		7.7	nm	
RMS Center Wavelength	1270	1360	nm	
Optical Output Eye Diagram	ITU-T G.957 compliant			Refer to fig. 1
Laser Diode Classification	IEC 60825-1 Class 1 compliant			
Optical Signal Polarity	Positive logic			

b) OD-J6502-0B01/HB01

Parameter	Specification		Unit	Note
	Min	Max		
Average Optical Output Power	-5	0	dBm	
Extinction Ratio	10		dB	
RMS Spectral Width		3	nm	
RMS Center Wavelength	1270	1360	nm	
Optical Output Eye Diagram	ITU-T G.957 compliant			Refer to fig. 1
Laser Diode Classification	IEC 60825-1 Class 1 compliant			
Optical Signal Polarity	Positive logic			

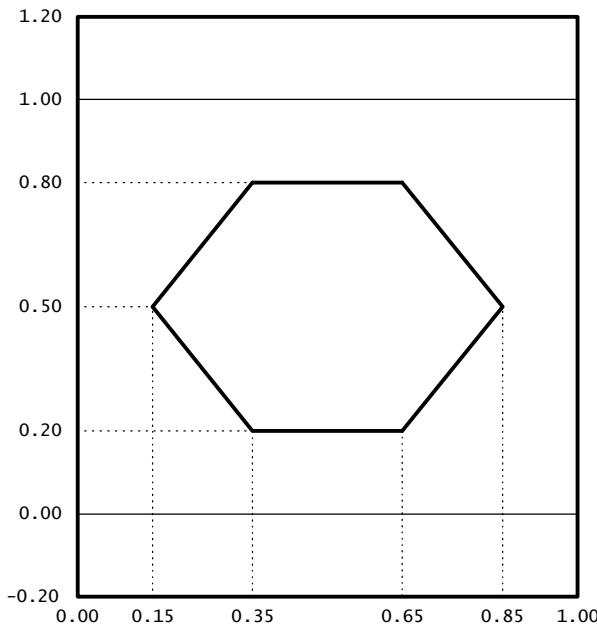

**Fig. 1** Optical output signal mask specifications of SONET/ITU standard specified by the waveform after passing through 4th order Bessel-filter which has cut-off frequency of 155.52MHz  $\times 0.75$ .

## 2-4. Electrical Signal Interface Specifications

### a) Data and Clock Input

Parameter	Specification			Unit
	Min	Max		
Input Signal Level	VIH	Vcc-1.2	Vcc-0.9	V
	VIL	Vcc-1.7	Vcc-1.4	
Data and Clock Signal	DATA IN  CLK IN (+)			
	$-1.5 \text{ ns} < t < 1.5 \text{ ns}$			

### b) Alarm Output (OPT OUT ALM, CURR ALM)

Parameter	Specification			Unit	
	Min	Max			
Output Level	VOH	0.9xVcc	Vcc	V	
	VOL	0	0.1xVcc		
Status	'L'	Fault condition			
	'H'	Normal operation			
Fan-out	IOH	-0.2			
	IOL	0.2			

### c) Control input (SHUT DOWN)

Parameter	Specification			Unit	
	Min	Max			
Input Level	VIH	2.0	Vcc	V	
	VIL	0	0.8		
Status	'L'	Optical output disable			
	'H'	Optical output enable			

### d) Control input (CURR ALM TST)

Parameter	Specification
Status	When CURR_ALM_TST is Connected to GND, CURR ALM will be asserted to 'L'. Leave open during normal operation.

e) Control Input (FF\_SEL)


Parameter	Specification
Status	When FF_SEL is Connected to GND, input data signal is retimed with input clock signal.
	When FF_SEL is Connected to Vcc through 10k ohm resistor, input data signal isn't retimed. CLK IN signals are not needed.

f) Performance Monitor

Parameter	Specification	Unit	Note
OPT MON	550 (Max)	mV	Voltage output. Please receive with high impedance (>1 M ohm) circuit.
BIAS MON	$42 \times I_b$ (Ib: Laser bias compensation current:[mA])	mV	Voltage output. Please receive with high impedance (>1 M ohm) circuit.

### 3. Functional Block Diagram

#### 3-1. Functional Block Diagram

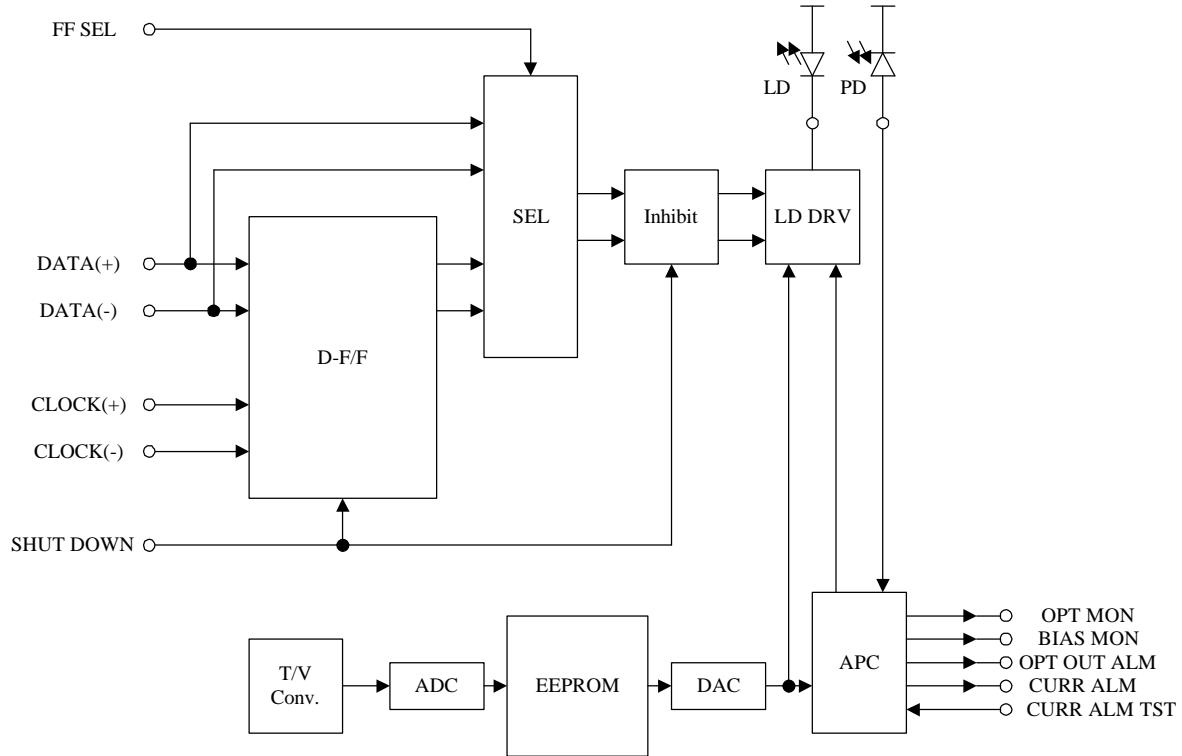

D-F/F: D-type flip-flop, LD DRV: Laser diode driver, DAC: Digital to analogue converter, T/V Conv.: Temperature to voltage converter, APC: Automatic power control circuit, ADC: Analogue to digital converter, EEPROM: Electronic erasable ROM, PD: PIN photo diode, LD: 1.31um Fabri-Pelot laser diode

#### 3-2. Alarm, Monitor and Control Function

Parameter	Symbol	Function
Optical output power loss alarm	OPT OUT ALM	To alert loss of power condition. Alarm does not assert until power degradation exceed 3 dB.
Laser degrade alarm	CURR ALM	To alert laser degradation. Alarm asserts when laser bias compensation current(Ib) increases by 25 mA +/- 5 mA from the initial value.
Laser shut down	SHUT DOWN	To shutdown laser output.
Current alarm test	CURR ALM TST	To test CURR ALM function. When connected to GND, CURR ALM is forced to active 'L'.
Laser bias current Monitor	BIAS MON	To monitor laser bias compensation current (Ib) . The Ib is calculated from output voltage (Vo) of this terminal; $Ib = Vo / 42 \text{ mA}$ . Initial value is nearly 0 V.
Optical output power monitor	OPT MON	To monitor the voltage that is proportional to optical launched power.

#### 4. Reliability

##### 4-1. FIT Number

450 FIT at +45 deg. C


##### 4-2. Reliability Test Items and Conditions

Item	Condition
Accelerated aging	+85 deg.C, +3.465 V, 5000 hours
Temperature cycle	-40 to +85 deg.C, 4 h/cycle, 500 cycles
Damp heat	+85 deg.C, 85%RH, 500 hours
Vibration	10 to 55 Hz, 1.5 mm, 1 hour for x, y, z each direction
Mechanical shock	50 G, 11 ms, 3 times for x, y, z each direction
Thermal shock	0 and +100 deg.C in water, 5 minutes each temperature, 20 cycles
Low temperature storage	-40 deg.C, 2000 hours

## 5. Package size, Pin Assignment

### 5-1. Outline diagram, Pin layout

a) OD-J6500-0B01/HB01, OD-J6502-0B01

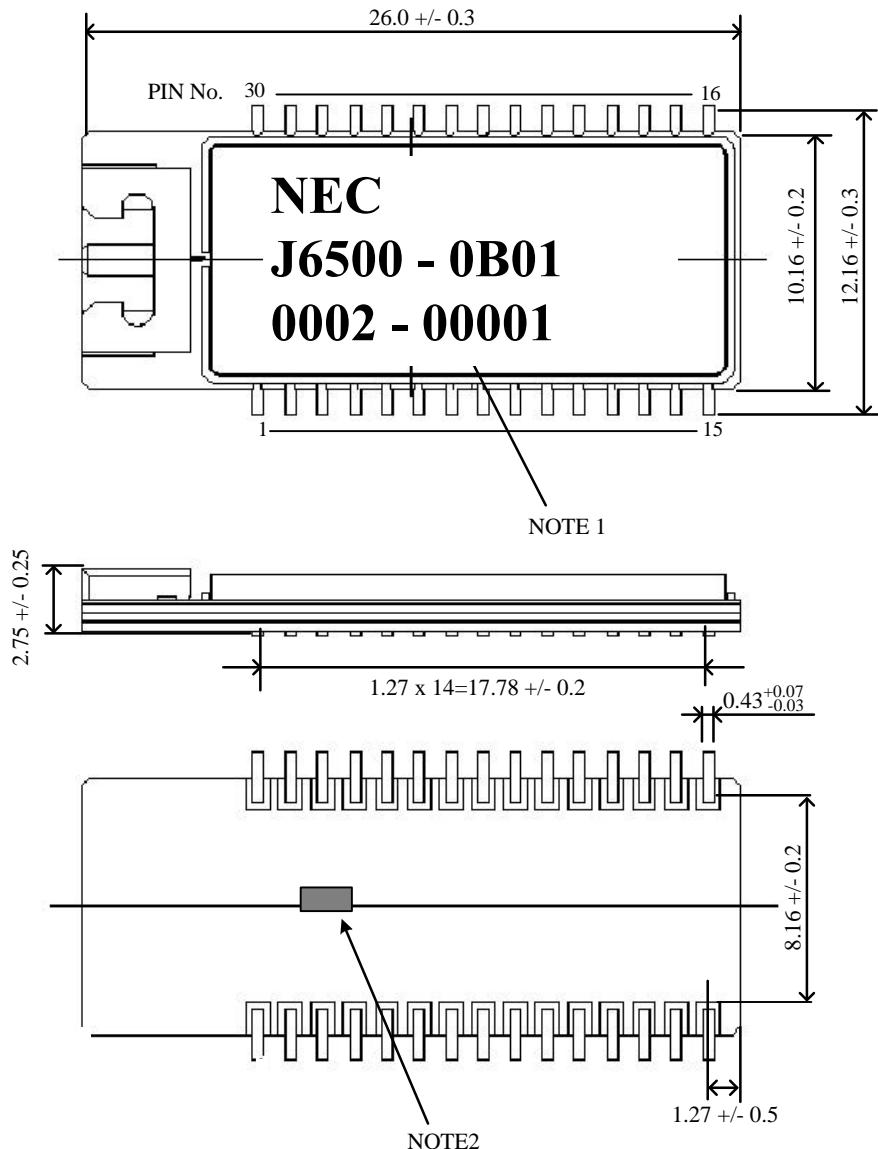

(Unit in mm)

Note1 Product name description is given below:


NEC :NEC logo mark

J650\*-B01 :Product Number

\*\*\*\*-\*\*\*\*\* :Production year/month-serial number

Note 2 Product testing terminal : Please keep open and don't connect to any other pattern or GND.

**b) OD-J6502-HB01**

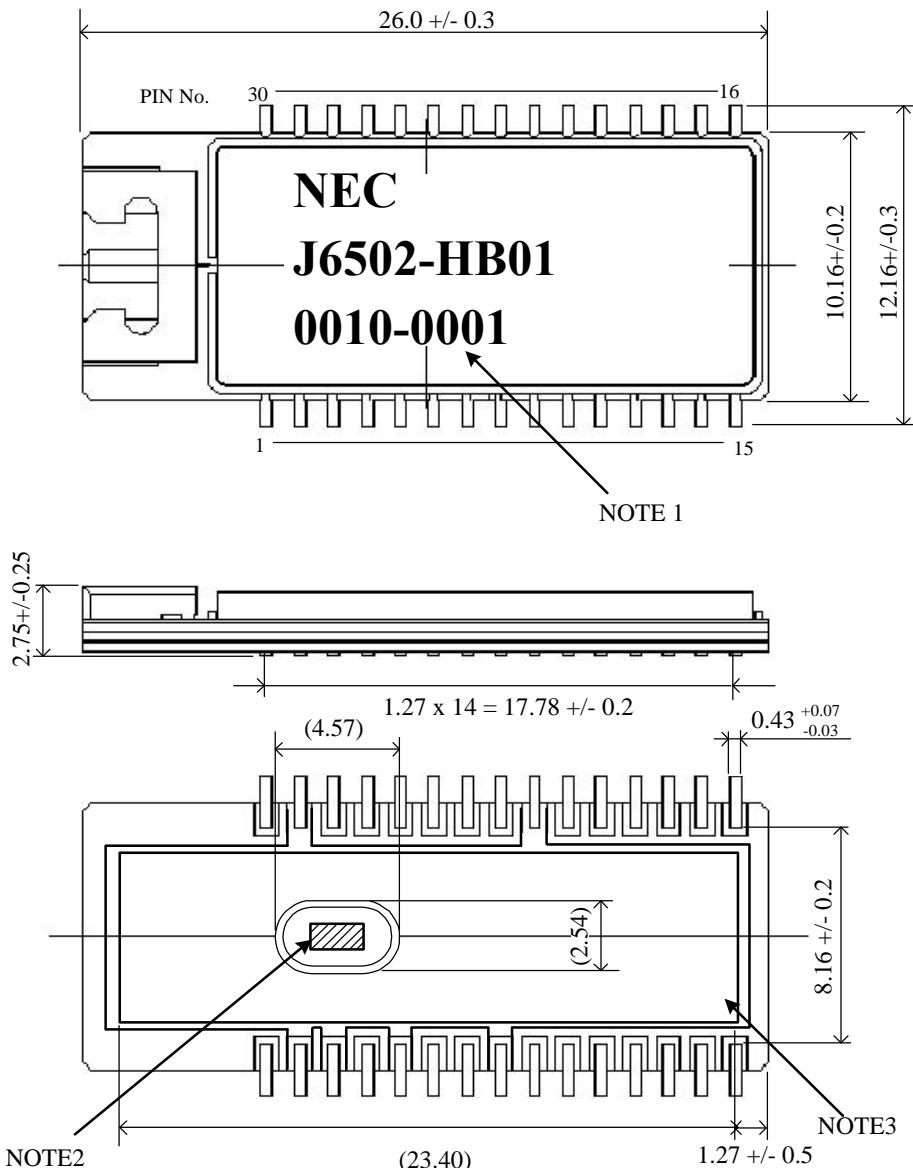

(Unit in mm)

Note1 Product name description is given below.

NEC :NEC logo mark

J6502-HB01 :Product Number

\*\*\*\*\* :Production year/month-serial number

Note 2 Product testing terminal. Please keep open and don't connect to any other pattern or GND.

Note 3 Re-flow solder this part with Printed Circuit Board(PCB) GND. See section 8.Recommended pattern layout.


## 5-2. Pin Assignment

Pin No.	Symbol	I/O	Notes
1	OPT MON	O	Refer to page 6, 7
2	GND	I	
3	GND	I	
4	FF SEL	I	Refer to page 6, 7
5	GND	I	
6	CLK IN (-)	I	Refer to page 5, 7
7	CLK IN (+)	I	Refer to page 5, 7
8	GND	I	
9	DATA IN (-)	I	Refer to page 5, 7
10	DATA IN (+)	I	Refer to page 5, 7
11	SHUT DOWN	I	Refer to page 5, 7
12	BIAS MON	O	Refer to page 6, 7
13	CURR ALM TST	I	Refer to page 5, 7
14	CURR ALM	O	Refer to page 5, 7
15	OPT OUT ALM	O	Refer to page 5, 7
16	GND	I	
17	GND	I	
18	GND	I	
19	GND	I	
20	EXT C	-	Connect a 0.1uF capacitor with GND. Refer to next page
21	Vcc	I	Refer to next page
22	GND	I	
23	GND	I	
24	GND	I	
25	GND	I	
26	GND	I	
27	GND	I	
28	Vcc	I	Refer to next page
29	GND	I	
30	Vcc	I	Refer to next page

I: input terminal, O: output terminal

## 6. Recommended peripheral circuit

It is necessary to use the circuit shown below. Please connect decoupling capacitors close to Vcc pins. As data and clock input pins are high impedance, external termination is necessary as close as possible. The type of termination depends on former circuit.

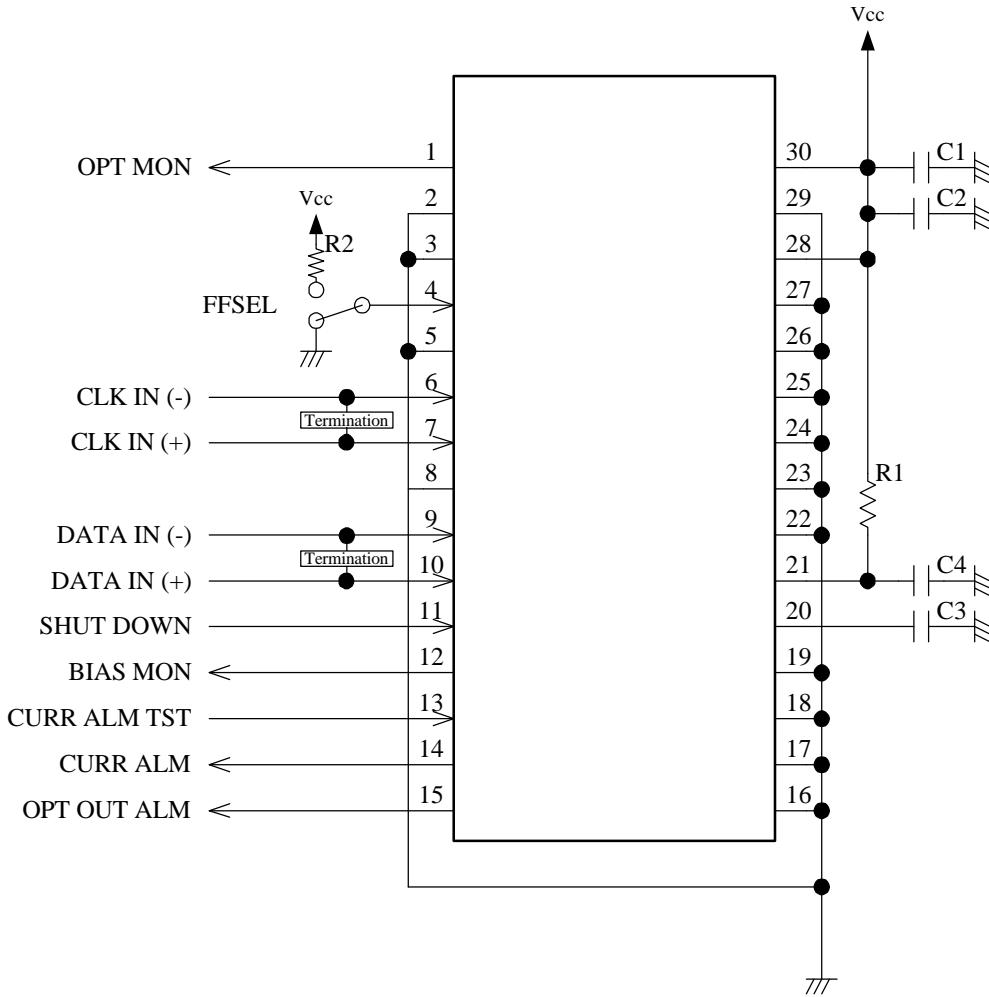


**Fig. 2** Recommended peripheral circuit


Peripheral circuit part list

Symbol	Description
R1	10 ohm, 1/16W
R2	10k ohm 1/16W
C1	10 uF +/-20%, 10V
C2	0.1 uF, +20% / -80 %, 10V
C3	0.1 uF, +/-20%, 10V
C4	10 uF +/-20%, 10V

## 7. Pad layout

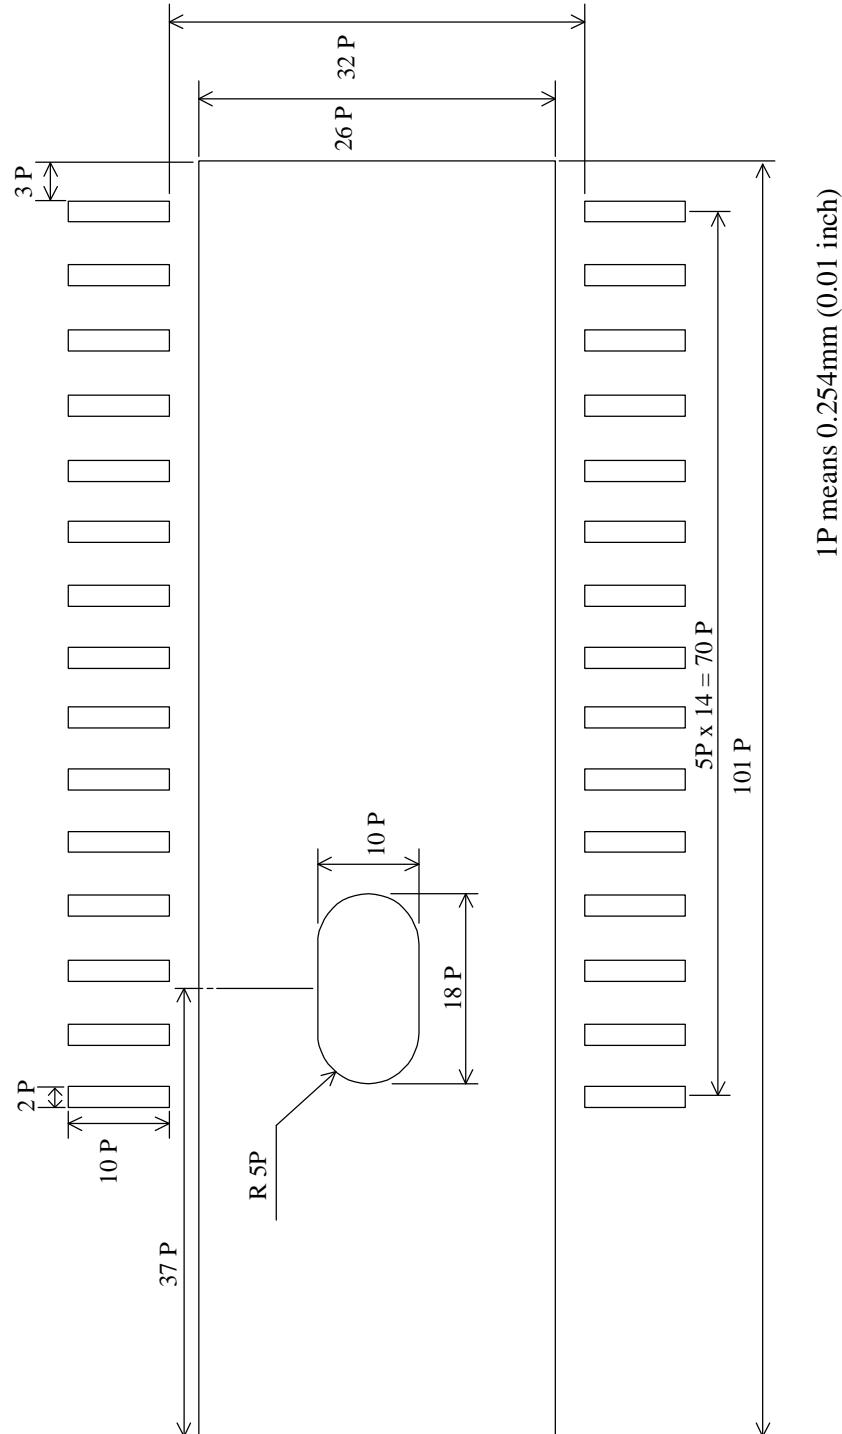


## 8. Recommended pattern layout

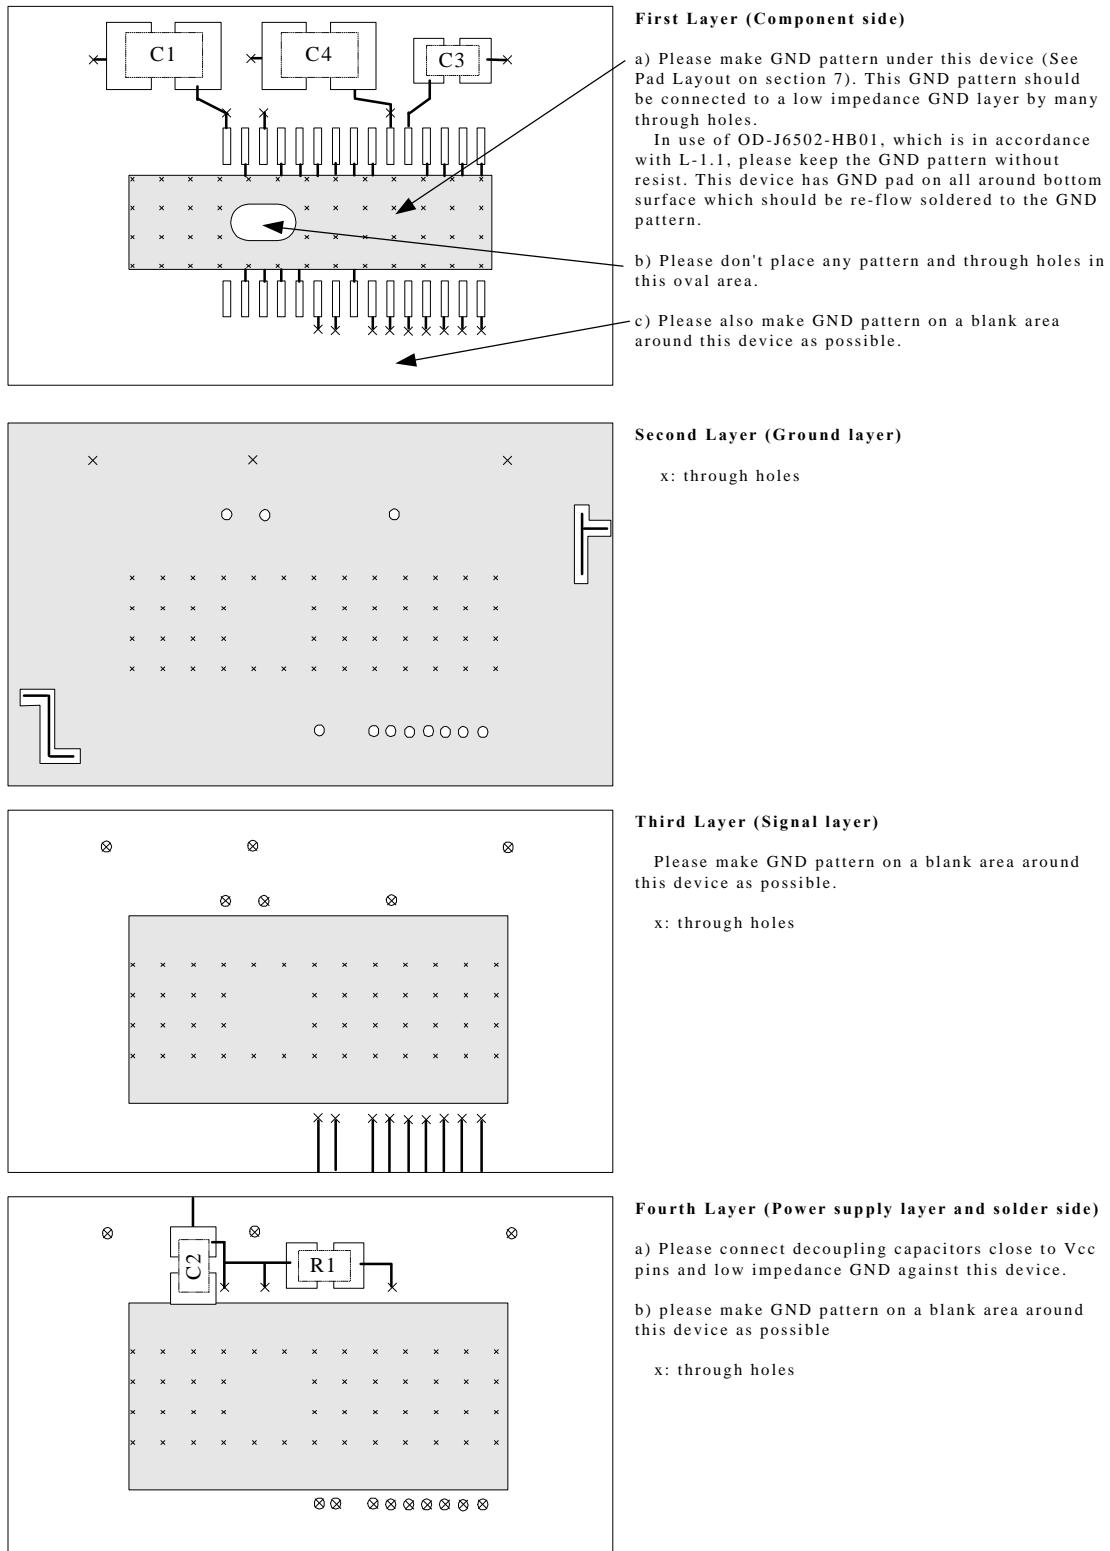

## 9. Typical operating characteristics


## 9-1. Optical output waveform

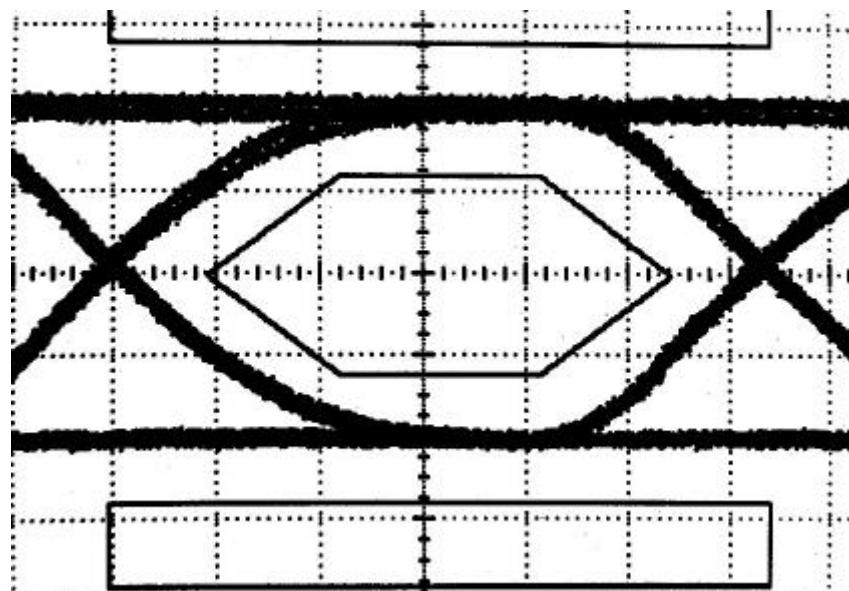

(1ns/div, +25deg.C)

## 10. Recommended Mounting Conditions


### 10-1. Mount prohibitive area

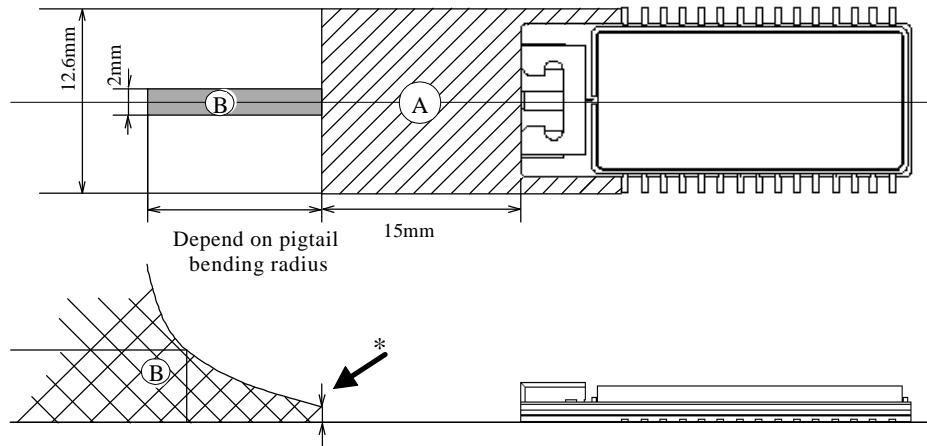

- a) 'A' is necessary space for the pigtail connection tool. Keep this area (12.6mm x 15.0mm) empty.
- b) 'B' is space for pigtail cord. Keep the bending radius of pigtail cord more than 30mm.
- c) Start bending pigtail cord after '\*' point.

### 10-2. Re-flow Soldering Conditions

- a) Soldering temperature: At the temperature more than +200 deg.C, the time should be less than 30 sec., +230 deg.C max.
- b) Pre-heating time: That is not specified particularly (depends on PCB). Typically +150 deg.C, 30 to 60 sec.
- c) Temperature rise and falling time: less than 5 deg.C/ sec.

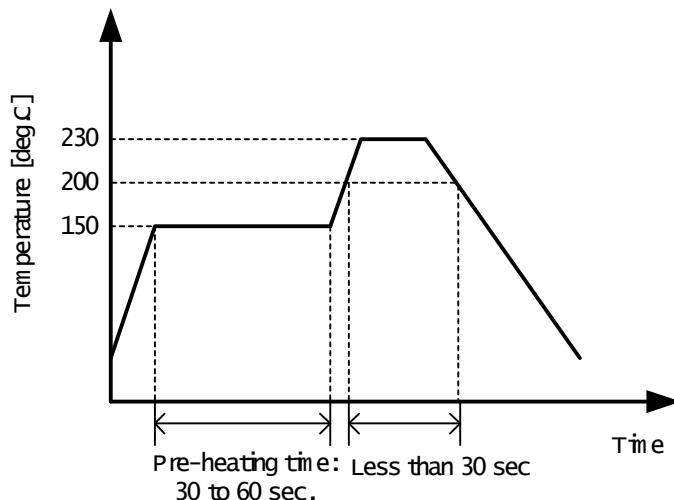


### 10-3. Solvent Cleaning

Solvent cleaning is not recommended.


### 10-4. Mounting Precautions

Do not remove safety cap over the ferrule at the time of re-flow soldering.

Please remove the safety cap after re-flow soldering.

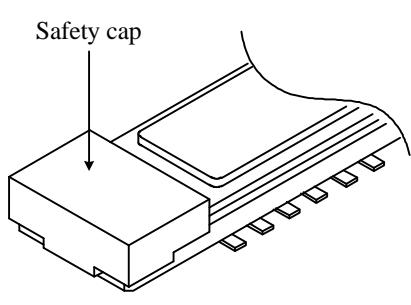

Safety cap mounted position

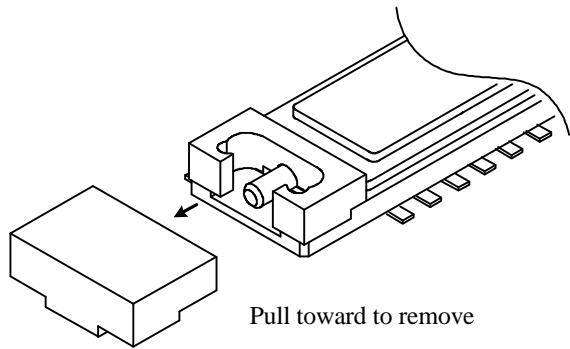

Safety cap removed position

### 10-5. De-soldering from the Printed Board


The product performance is not guaranteed in case of de-soldering from a PCB. If it is necessary to de-solder, Please detach pigtail in advance. Pigtail can be used again.

### 10-6. Pigtail Attachment

Pigtail should be attached after soldering the product on PCB. Please pay attention to following points while attaching a pigtail:

- To attach pigtail use pigtail attach / detach tool specially designed for this device.
- Please refer to instruction manual of pigtail attach / detach tool for details. (Supplied separately)
- Ferrule may be broken upon applying excess strength and its characteristics may be changed.  
Don't stretch or bend pigtail cord more than specified values. Recommended value for stretch is less than 200gf and bending radius should be more than 30 mm.

d) Please clean the ferrule surface by a cotton stick before attaching a pigtail.

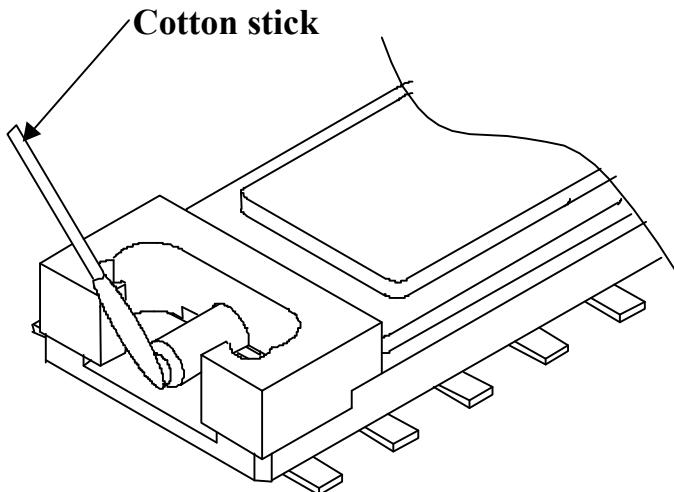


Recommended cotton stick

Maker :NTT ME


Product name :CLETOP stick type

Product Number :14100400

## 10-7. Shipment Packing

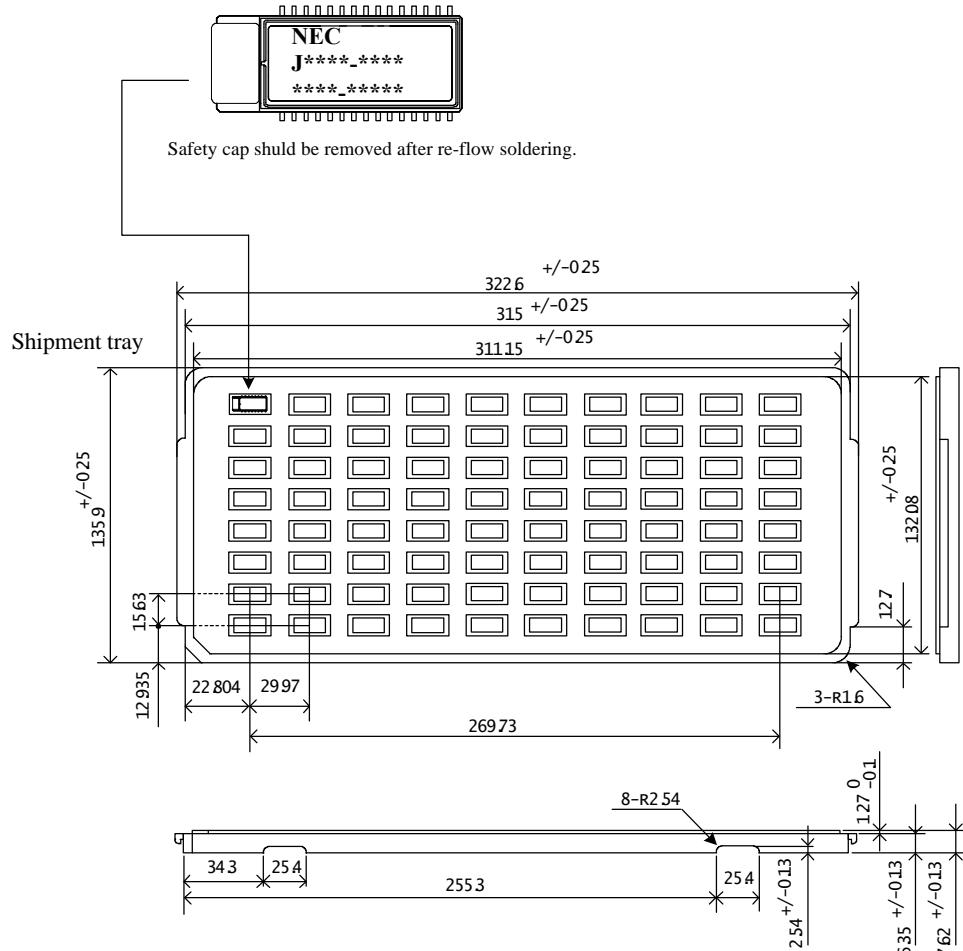

Direction of mounting to the shipment tray

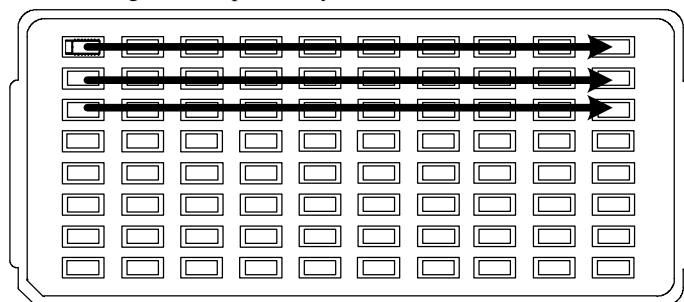

## 11. Application Precautions

- a) To prevent optical connector surface from crack or stain, please put the dust cap while this device is not in use. When the connector surface is stained, please wipe with a kind of lens paper.
- b) The bending radius for pigtail fiber cord should be more than 30mm.
- c) Optical components are mounted inside this device. Please handle with care. Mechanical shock due to falling could lead permanent damage.
- d) The device performance given in this manual is guaranteed for correct applications. Device performances are not guaranteed under incorrect use.
- e) Sudden heating or cooling by dryer or cooling spray could lead permanent damage to the device. The device may not work normally while sudden heating or cooling.
- f) This product should be handled as a CMOS product.