

TOSHIBA CMOS DIGITAL INTEGRATED CIRCUIT SILICON MONOLITHIC


TC83230-0022**TC83230-0022 : SINGLE-CHIP CMOS LSI FOR CALCULATORS WITH PRINTERS****(APPLICABLE PRINTER HEADS : M31T, M32T MANUFACTURED BY EPSON)**

The TC83230-0022 LSI is a single-chip CMOS LSI for use in calculators with printers.

It integrates I/O logic circuits necessary to configure a calculator with 10- and 12-digit display, two-memory function, serial printer used to print calculation results, oscillator, and LCD drivers.

FEATURES**Operational Features**

- Print
 - 13 digits of data.
(including decimal point.)
 - 1 digit of minus sign, operational symbol.
 - 2-color printing (black and red).
- Display
 - 10 and 12 digits of data. (including punctuation in each digit.)
 - 1 digit of floating minus sign, memory load, error symbol, grand total memory load, 3 digits of commas.
- Decimal output
 - Decimal set lock key controls output format. Fixed decimal setting ("0", "1", "2", "3", "4", "6"), full floating decimal, and ADD mode.
- Key-input buffer
 - 12 words
- Operation methods
 - addition and subtraction : by ARITHMETIC operation
 - multiplication and division : by algebraic operation

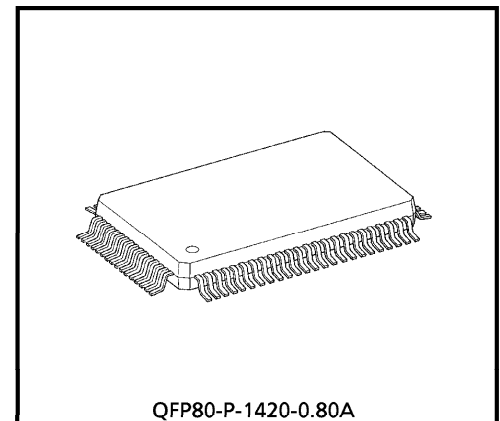

Weight : 1.52 g (Typ.)

980910EBA1

- TOSHIBA is continually working to improve the quality and the reliability of its products. Nevertheless, semiconductor devices in general can malfunction or fail due to their inherent electrical sensitivity and vulnerability to physical stress. It is the responsibility of the buyer, when utilizing TOSHIBA products, to observe standards of safety, and to avoid situations in which a malfunction or failure of a TOSHIBA product could cause loss of human life, bodily injury or damage to property. In developing your designs, please ensure that TOSHIBA products are used within specified operating ranges as set forth in the most recent products specifications. Also, please keep in mind the precautions and conditions set forth in the TOSHIBA Semiconductor Reliability Handbook.
- The products described in this document are subject to the foreign exchange and foreign trade laws.
- The information contained herein is presented only as a guide for the applications of our products. No responsibility is assumed by TOSHIBA CORPORATION for any infringements of intellectual property or other rights of the third parties which may result from its use. No license is granted by implication or otherwise under any intellectual property or other rights of TOSHIBA CORPORATION or others.
- The information contained herein is subject to change without notice.

- Function
four function, repeat multiplication and division, mixed calculation, square calculation, percentage calculation, percent discount and add-on calculation, memory calculation, delta percent calculation, add-mode calculation, mark-up / down calculation, total calculation, constant calculation, tax calculation
Two-key rollover
- Leading zero suppression


Protection

- i) In the overflow condition, all key except "C", "C/CE", "CE", "Feed", "→" key are inoperative.
- ii) Key chatter protection (at $f = 4 \text{ MHz}$)


Auto-clear at power on

Auto-clear functions by connecting a capacitor to the RESET pin.


SYSTEM BLOCK DIAGRAM

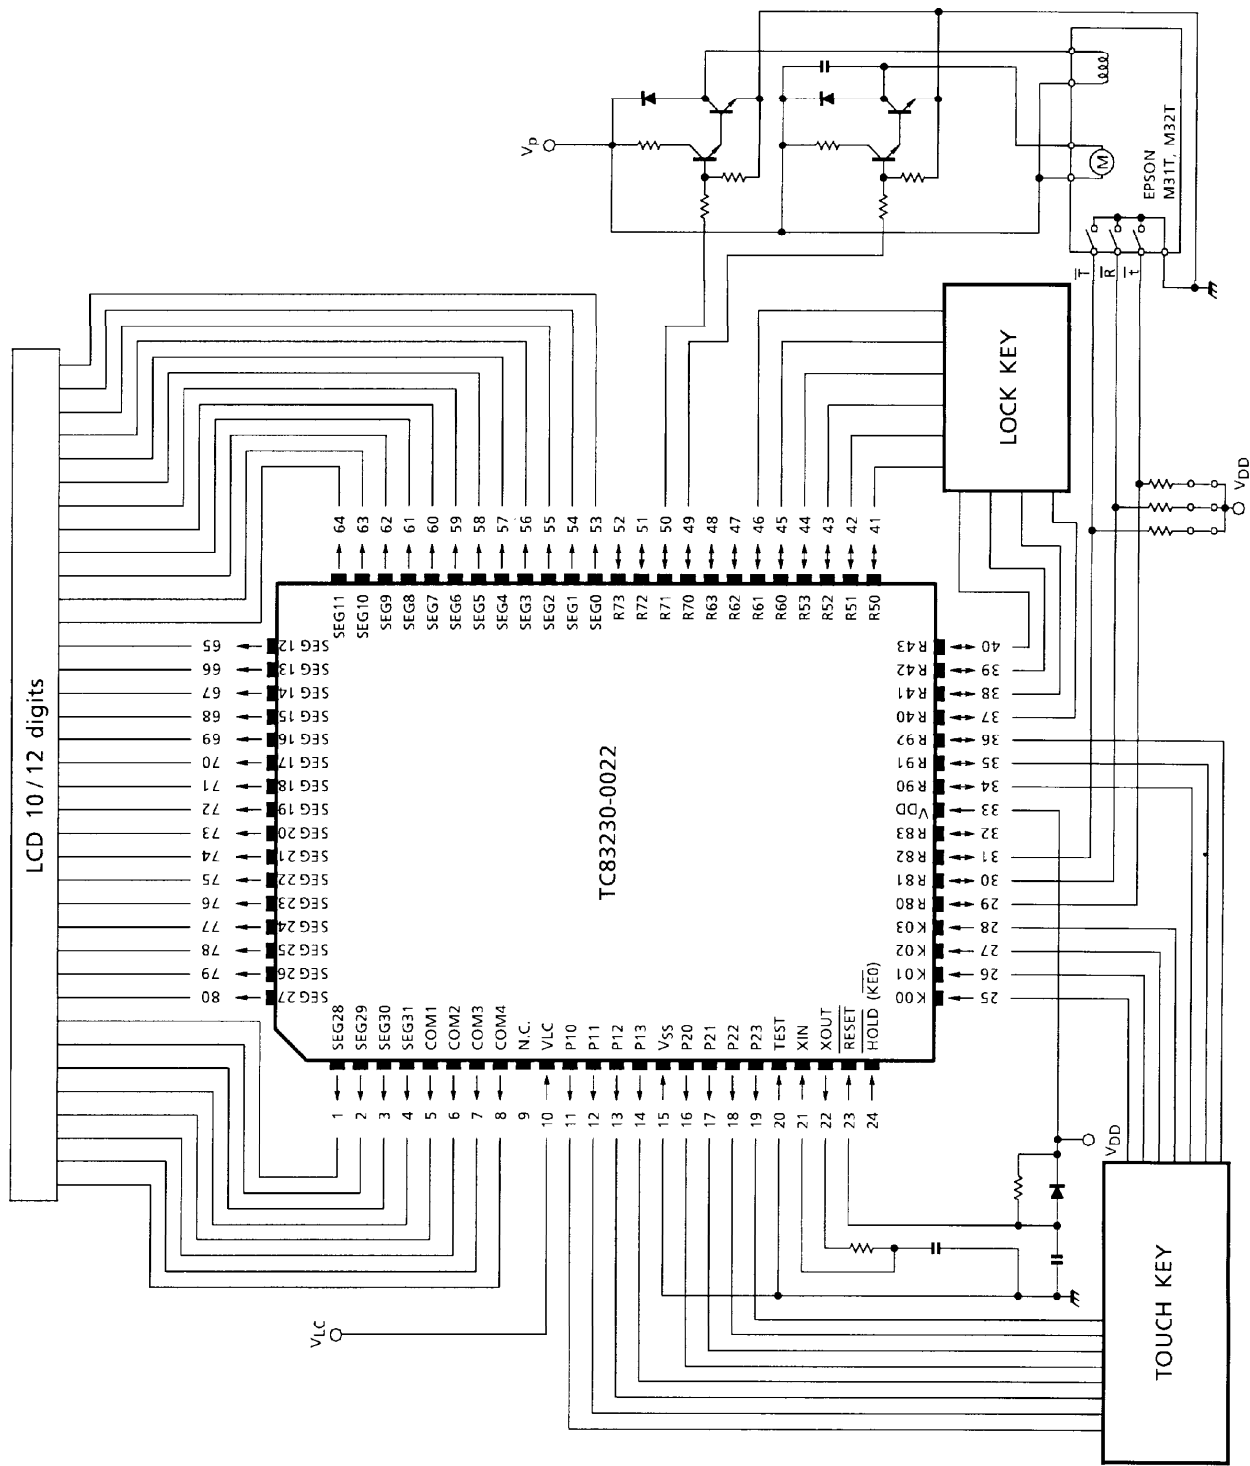


CONNECTION OF LCD
SEGMENT

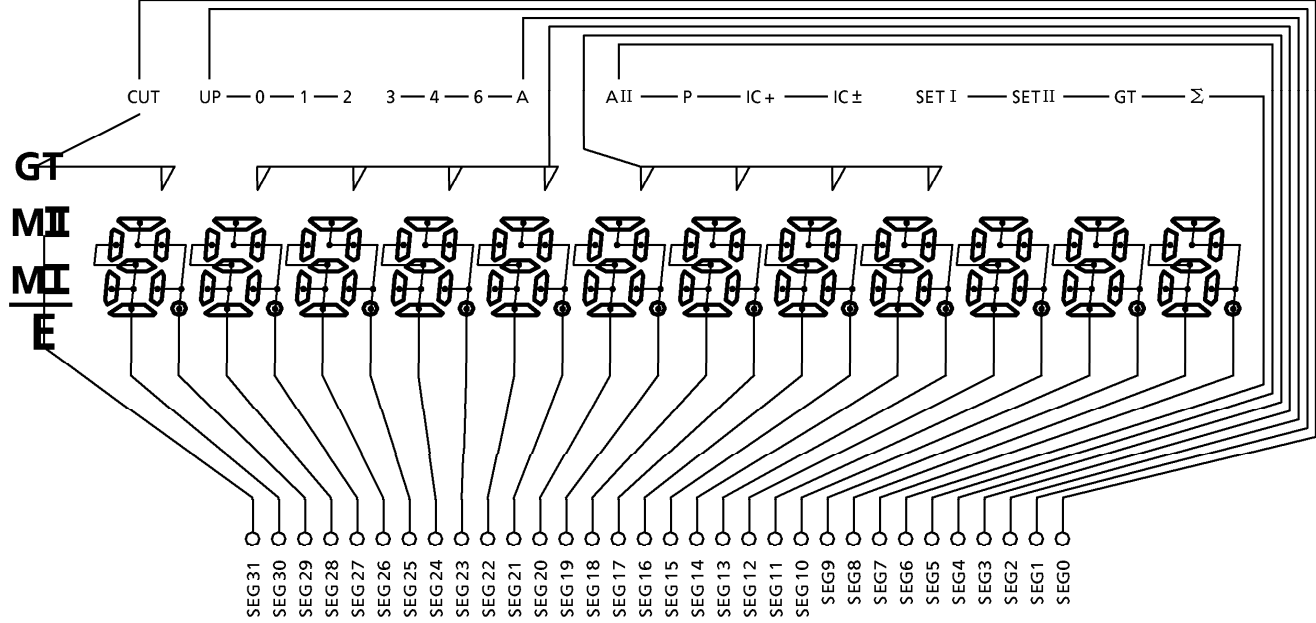


COMMON

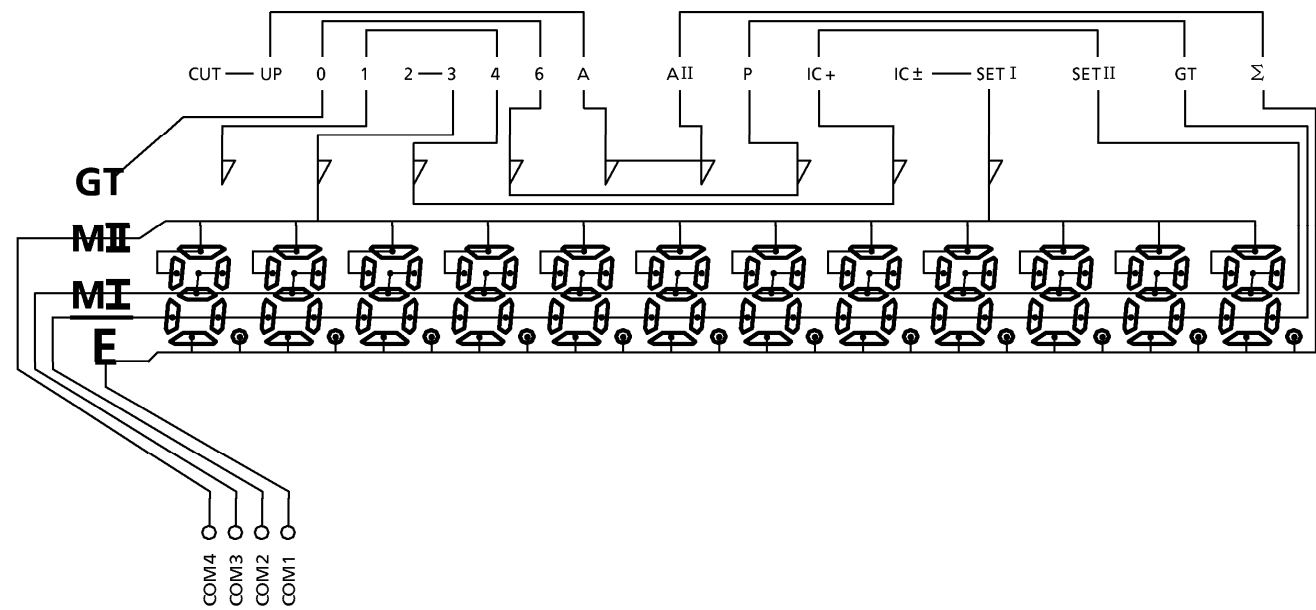

KEY CONNECTION

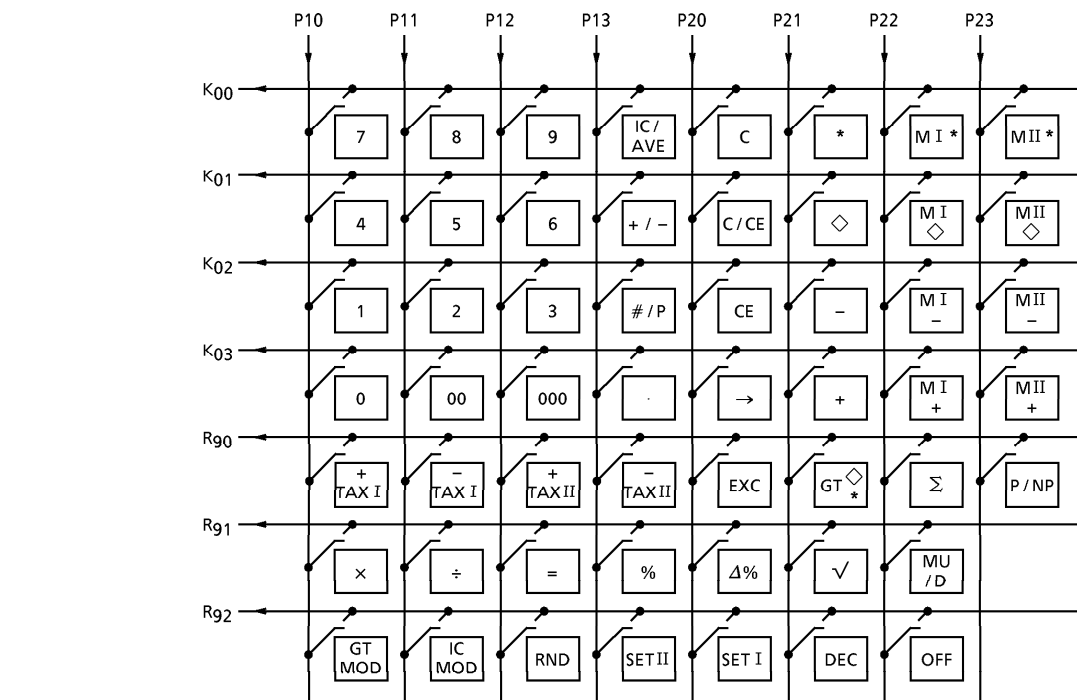


Touch Key

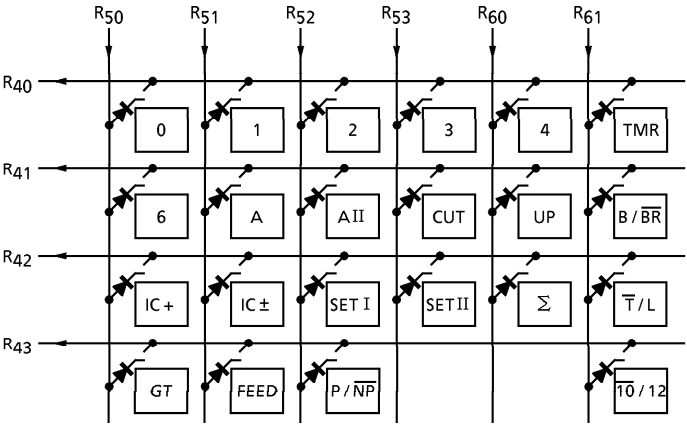


Lock Key

Touch Key select

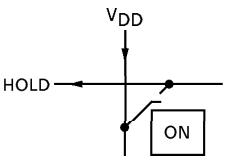

ON Key

PIN ASSIGNMENT
QFP80

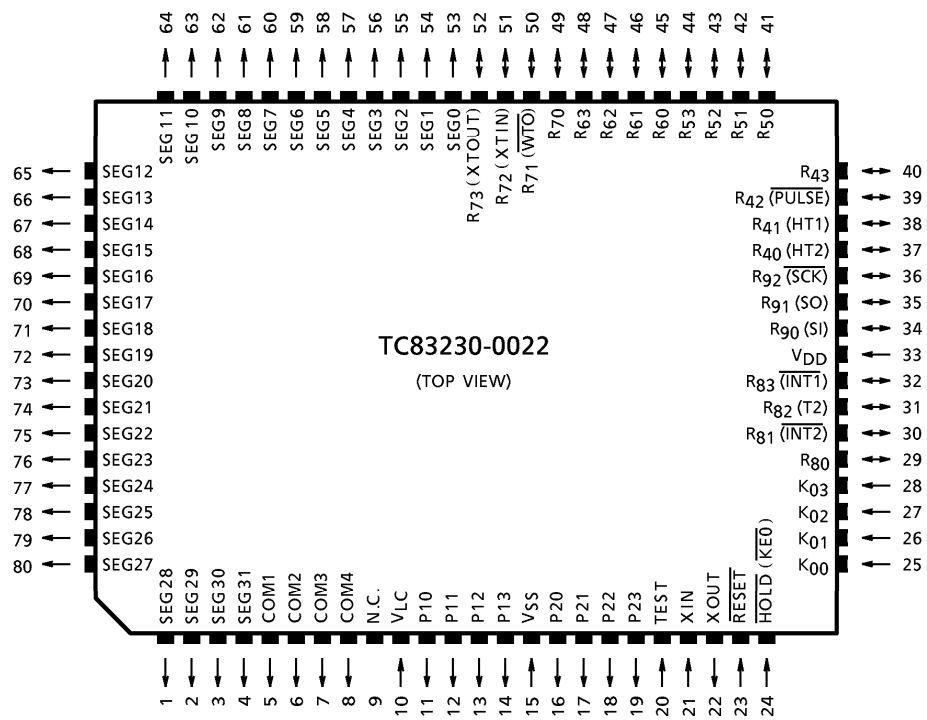

SPECIFICATION OF CALCULATOR

Operation specifications

1) Operations depending on key types and modes

● Touch key

KEY NAME	CAL MODE		TAX SET MODE (SET I / II key is on)	
	Touch key mode	Lock key mode	Touch key mode	Lock key mode
C	Operates as clear key	Operates as clear key	Clears input data	Clears input data
CE	Operates as clear entry key	Operates as clear entry key	Clears input data	Clears input data
C / CE	Operates as clear or clear entry key	Operates as clear or clear entry key	Clears input data	Clears input data
Numeral	Numerals Key-inputs numerals	Numerals Key-inputs numerals	Input numerals	Input numerals
OFF	Operates as off key	—	Unused	Unused
.	Key-inputs decimal points	Key-inputs decimal points	Key-inputs decimal points	Key-inputs decimal points
*, ◇	Operates as total or sub-total key	Operates as total or sub-total key	Unused	Unused
+, - ×, ÷	Operates as four-function key	Operates as four-function key	Unused	Unused
=	Operates as = key	Operates as = key	Unused	Unused
P / NP	Switches print or non-print	—	Unused	Unused
RND	Switches round-off and round-up	—	Unused	Unused
DEC	Switches decimal points	—	Unused	Unused
%	Operates as % key	Operates as % key	Unused	Unused
Δ%	Operates as delta percentage calculation key	Operates as delta percentage calculation key	Unused	Unused
MU / D	Operates as mark-up/down key	Operates as mark-up/down key	Unused	Unused
IC / AVE	Operates as item count key	Operates as item count key	Unused	Unused
# / P	Operates as non-add-print key for left-justified printing	Operates as non-add-print key for left-justified printing	Unused	Unused
→	Operates as right-shift key	Operates as right-shift key	Operates as right-shift key	Operates as right-shift key
+ / -	Operates as sign change key	Operates as sign change key	Unused	Unused

KEY NAME Mode switch	CAL MODE		TAX SET MODE (SET I / II key is on)	
	Touch key mode	Lock key mode	Touch key mode	Lock key mode
M I *, M II * M I ◇, M II ◇ M I -, M II - M I +, M II +	Operates as memory function key	Operates as memory function key	Unused	Unused
- TAX I / II	Operates as - TAX I / II key	Operates as - TAX I / II key	Unused	Unused
+ TAX I / II	Operates as + TAX I / II key	Operates as + TAX I / II key	Unused	Unused
Σ	Operates as Σ key	—	Unused	Unused
IC MOD	Operates as IC-mode key	—	Unused	Unused
GT MOD	Operates as GT-mode or non-GT mode key	—	Unused	Unused
GT	Operates as GT key	Operates as GT key	Unused	Unused
EXC	Operates as EXC key	Operates as EXC key	Unused	Unused
$\sqrt{\quad}$	Operates as $\sqrt{\quad}$ key	Operates as $\sqrt{\quad}$ key	Unused	Unused

● Lock key

KEY NAME Mode switch	CAL MODE		TAX SET MODE (SET I / II key is on)	
	Touch key mode	Lock key mode	Touch key mode	Lock key mode
0, 1, 2, 3, 4, 6, A, AII	—	Switches decimal points	Unused	Unused
CUT, UP	—	Switches round-off and round-up	Unused	Unused
IC $\pm$, IC +	—	Operates as IC $\pm$ / IC + key	Unused	Unused
Σ	—	Operates as Σ key	Unused	Unused
GT	—	Switches GT-mode or non-GT mode	Unused	Unused
FEED	Operates as paper feed key	Operates as paper feed key	Operates as paper feed key	Operates as paper feed key
P / $\overline{NP}$	—	Switches point or non-point	Unused	Unused

2) Explanation of function

- [0~9] Keys in numbers from 0 to 9, 00, and 000. If the number of displays digits exceeds 10 or 12 key entry is invalid.
- [00, 000]
- [.] If this key is pressed after a key operation except data entry, the displays is cleared and entry of [.] is stored in memory. The decimal point is shifted for subsequent data entry. If the [.] key is pressed during data entry, displays does not change.
- [+, -] Add or subtract operation data and displays the result. The decimal point is floating except when A mode is specified. Addition or subtraction can be performed repeatedly.
- If these key are pressed in multiplication /division mode or in constant calculation mode, add or subtract displays data to addition /subtraction registers, then displays the result. At this time, in the operation mode multiplicand or divisor do not change.
- These keys increment or decrement the item counter. In the following operation mode, the operations are executed, and the results are printed and displayed. At that time, addition or subtraction using the addition /subtraction register is not executed.
- (1) percent discount /add-on calculation
- $$a \times b\% + \cdots a + (ab / 100)$$
- $$c\% + \cdots a + (ac / 100)$$
- $$a \times b\% - \cdots a - (ab / 100)$$
- $$c\% - \cdots a - (ac / 100)$$
- Percent discount /add-on with constants are calculated as above.
- [◇] Prints and displays the intermediate result in addition /subtraction register. In item count mode, prints the contents of the item counter before the calculation result printing.
- Contents of data register or stored arithmetic instruction are not changed.
- [*] Prints and displays the result in addition /subtraction register. Automatically feeds paper one line. In item count mode, the contents of the item counter are printed before the calculation result printing.
- After this key operation, the contents of the addition /subtraction register are cleared. The contents of the item counter are cleared at the first addition / subtraction in next step. The contents of the data register or stored arithmetic instruction are not changed. When GT mode is specified, the result of addition /subtraction is added to the GT memory.

- $\left[\begin{array}{l} \text{MI} +, \text{MII} + \\ \text{MI} -, \text{MII} - \end{array} \right] \dots$ If the arithmetic instruction is not stored or if the mode is constant calculation mode, first prints the displays contents after rounding to the specified number of decimal places, performs addition/subtraction using the data in memory, then stores the result in memory. If the multiplication/division instruction is stored, executes the arithmetic instruction, rounds the result to the specified number of decimal places, prints and displays the result, adds/subtracts with the data in memory, then stores the result to memory.
 At that time, the multiplicand or divisor is stored together with the mode, constant calculation mode. When this key is pressed immediately after the [×] or [MI +, MII +, MI -, MII -] key, operation is the same as that for the [=] key; that is, adds/subtracts using data in memory. This key operation increments or decrements the item counter for memory.
- [MI ◇, MII ◇] . Prints or displays the intermediate result of memory calculation. In item count mode, prints the contents of the item counter for memory before the calculation result printing. Contents of the data register or stored arithmetic instruction are not changed.
- [MI *, MII *] .. Prints and displays the result of memory calculation and automatically feeds paper one line. In item count mode, prints the contents of the item counter for memory before the calculation result printing. After the [MI *, MII *] key operation, the contents of memory and the contents of the item counter for memory are cleared. Contents of the data register or stored arithmetic instruction are not changed.
- [×, ÷] If the multiplication or division instruction is stored in memory, prints the operators, performs the operations and displays the results while simultaneously storing a new arithmetic instruction in memory. The decimal point for the result is floating. If the [×] or [÷] key is pressed in constant calculation mode, prints the displayed numeric value without performing an operation and stores a new multiplication/division instruction in memory.
- [=] Executes a stored multiplication/division instruction, rounds the result to the specified number of decimal places, prints and displays the result, then automatically feeds the paper one line. Stores the multiplicand or divisor together with constant calculation mode in memory. If an instruction is not stored in memory, no operation is performed and the previous state is held. Pressing the [=] key immediately after the [×] or [÷] key performs the following operation.

$$a \times = \cdots \cdots aa$$

$$a \div = \cdots \cdots 1$$

[%] If an arithmetic instruction is stored in memory, performs percentage calculation, rounds the result to the specified number of decimal places, prints and displays the result. Stores the multiplicand/divisor together with constant calculation mode in memory. If a percentage calculation for multiplication is performed, percent discount/add-on calculation can be done by using the [+] or [-] key. At that time, addition/subtraction using the addition/subtraction register is not performed. If an arithmetic instruction is not stored in memory, no operation is performed and the previous state is held. Pressing the [%] key immediately after the [×] or [÷] key performs the following operation.

$$a \times \% = \dots aa / 100$$

$$a \div \% = \dots 100$$

% key operation example : percent discount/add-on calculation

$$a \times b\% \dots ab / 100$$

$$+ \dots a + (ab / 100)$$

$$c\% \dots ac / 100$$

$$+ \dots a + (ac / 100)$$

$$a \times b\% \dots ab / 100$$

$$- \dots a - (ab / 100)$$

$$c\% \dots ac / 100$$

$$- \dots a - (ac / 100)$$

[MU/D] If a multiplication/division instruction is stored in memory, cancels the data. The decimal point for the result is floating.

MU/D key operation example :

$$aMU/Db = \dots a / (1 - (b / 100)) - a \quad (\text{Prints profit})$$

$$a / (1 - (b / 100)) \quad (\text{Mark-up})$$

$$c = \dots a / (1 - (c / 100)) - a \quad (\text{Prints profit})$$

$$a / (1 - (c / 100)) \quad (\text{Mark-up})$$

$$aMU/Db + / - = \dots a / (1 + (b / 100)) - a \quad (\text{Prints profit})$$

$$a / (1 + (b / 100)) \quad (\text{Mark-down})$$

$$c + / - = \dots a / (1 + (c / 100)) - a \quad (\text{Prints profit})$$

$$a / (1 + (c / 100)) \quad (\text{Mark-down})$$

- [Δ%] If a multiplication/division instruction is memorized, cancels the data.
 Δ%key operation example :

$$a\Delta\% b = \dots\dots\dots b - a$$

$$(b - a) / |a| \quad (\text{Prints difference})$$

$$c = \dots\dots\dots c - a \quad (\text{Change delta percent})$$

$$(c - a) / |a| \quad (\text{Prints difference})$$

$$a\Delta\% b + / - = \dots\dots\dots - (b + a) \quad (\text{Change delta percent})$$

$$- (b + a) / |a| \quad (\text{Prints difference})$$

$$c + / - = \dots\dots\dots - (c + a) \quad (\text{Change delta percent})$$

$$- (c + a) / |a| \quad (\text{Prints difference})$$
- [+ / -] Inverts sign of the displayed number at key entry.
- [→] Shifts the contents of the displays to the right by one digit at key entry. For an estimation calculation error, cancels the error.
- [GT $\diamond$ *] Calls the contents of GT memory. If the key is pressed once, calls the contents of GT memory, but does not change current state. If the key is pressed twice, calls the contents of GT memory and clears them.
- [C] Cancels all arithmetic instructions and errors, clears the contents of all the registers except the memory register, and prints 0.C.
- [CE] If pressed at key entry, clears only the contents of the displays ; does not change the stored arithmetic instruction or the contents of the data register. Invalid if pressed after one of the following keys : [C] [×] [÷] [+][−][=][%] [Δ%] [MI +, MII +] [MI −, MII −] [MI $\diamond$, MII $\diamond$] [MI *, MII *] [MU / D] [IC / AVE] .
 The result of pressing the [CE] key after the [# / P] key depends on the state before the keys were pressed.
- [IC +] Selects item count mode.
- [IC ±] IC + ... Counts up by the [+] or [−] key.
 IC ± ... Counts up by the [+] key, down by the [−] key.
- [Σ] If an operation is performed by the [=] or [%] key in auto accumulation calculation mode, adds the operation result to the addition/subtraction register and increments the item counter.
- [GT] In grand total mode, adds the total register to the GT register by the [*] key.

- [C/CE] If pressed at key entry, operates same as the [CE] key.
If pressed after one of the following keys, operates same as the [C] key : [C/CE] [×] [÷] [+] [-] [=] [%] [Δ%] [M I +, M II +] [M I -, M II -] [M I ◇, M II ◇] [M I *, M II *] [MU/D] [IC/AVE].
The result of pressing the [C/CE] key after the [+/-] or the [# / P] key depends on the state before the keys were pressed.
- [# / P] If pressed after the numerical key entry, prints the contents of the key entry data register together with the # symbol, but does not change the current state. If the key is pressed after a key except the numerical keys or [+/-] key, does not change the contents of the displays or the current state. If the key is pressed in clock mode, automatically prints the displayed date and time.
- $\left[\begin{array}{l} + \text{TAX I} / \text{II} \\ - \text{TAX I} / \text{II} \end{array} \right] \dots$ Calculate included tax operation or excluded tax operation. But, only prints and does not express the tax. Prints or displays the result-value. (Result-value adjusts decimal-point (TAB) setting.) Feeds the paper one line after prints.
TAX I key operation example : (TAX = 3%)
 $a [+ \text{TAX I}] \dots a (3 / 100)$ (Prints TAX)
 $a + (a (3 / 100))$ (Included TAX)
 $a [- \text{TAX II}] \dots a / (1 + 3 / 100) - a$ (Prints TAX)
 $a / (1 + 3 / 100)$ (excluded TAX)
- If pressed at key entry after number key entry, calculate the tax as a result of calculation.
- When multiplication/division instruction is stored in memory.
- [P / NP] Switches between PRINT and NON-PRINT mode. At reset, NON-PRINT mode is set. Switches mode in each time when the [P / NP] key is pressed :
P → NP → P → NP. In PRINT mode, displays "print mode". Valid only when the $\overline{\text{T}} / \text{L}$ lock key is off.
- [RND] Switches between round-up, round-off and half-adjust. At reset, half-adjust is set. Switches the mode in each time when the [RND] key is pressed : 5 / 4 → ↓ → ↑ → 5 / 4 → ↓ → ↑. Displays round-up/round-off. Valid only when the $\overline{\text{T}} / \text{L}$ lock key is off.
- [EXC] If an multiplication or division instruction is not stored in memory, it is invalid. Constant calculation of multiplication or division instruction exchange for the value of displays, and displays it.
- [GT MOD] Exchange GT-mode. (Initial setting isn't support GT-mode.)
GT-mode cycles not-support and support. And displays GT-mode flag.
Only touch key mode is valid.

- [IC MOD] Exchange IC-mode. (Initial setting isn't support IC-mode.)
IC-mode cycles not-support, IC + and IC ±-mode. And displays IC-mode flag.
Only touch key mode is valid.
- [√] Operates root-instruction and displays result-value with prints. (Result-value
adjusts decimal-point (TAB) setting.)
After points feeds the paper one line. If the value is minus, change to the
plus value and operate root-instruction. Then produce an estimate calculation-
error. But keep the arithmetic instruction and date-register.
- [IC / AVE] Prints or displays the item counter. When IC / AVE key continuously pressed
twice just after pressed [*] key and [◇] key, after first, prints or displays the
item counter.
The second, the calculation of the mean number are executed, prints or
displays the operation result.
After calculation of the mean number, item counter are cleared.

Example

a (+)	[]	Addition to total addition Substraction register	(*)	→ Displays or prints addition Substraction register
b (+)				
c (+)				
d (+)				
e (+)				
f (+)				
g (+)				
			(IC / AVE)	→ Displays the item counter
			(IC / AVE)	→ Displays or prints (a + b + c + d + e + f + g) / 7

Then even if IC-value is a negative, the calculation of the mean number.

Example

a (-)	[]	Addition to total addition Substraction register	(*)	→ Displays or prints addition Substraction register
b (-)				
c (+)				
d (-)				
			(IC / AVE)	→ Displays the item counter
			(IC / AVE)	→ Displays or prints (a - b - c + d) / - 2

- [DEC] Switches the decimal point. At reset, floating point (F) is set. Switches the
mode in each time when the [DEC] key is pressed as follows : F→0→1→2→3
→4→6→A→AII →F→0→1. Displays the specified decimal point or add mode.
Valid only when the [T / L] lock key is off.

3) Explanation of lock keys

- [0, 1, 2, 3] Sets the specified decimal point. If no specification, floating is set.
- [4, 6, A, AII] When processing floating point data, the operation result is zero-shifted. When A mode is specified, key-entered data are multiplied by 1 / 100 only when the key-entered numerical value is used for addition / subtraction or memory addition / subtraction. If the [.] key is pressed during data entry, A mode is invalid. The operation result is treated the same as the specified decimal point, 2. When AII mode is specified, key-entered data are multiplied by 1 / 100 only when the key-entered numerical value is used for multiplication / division by [=] key. If the [.] key is pressed during data entry, AII mode is invalid. The operation result is treated the same as the specified decimal point, 2.
- [CUT, UP] Rounds-off in CUT mode ; rounds-up in UP mode ; when no specification is made, half-adjusts. When a decimal point is specified, the digit(s) in the subsequent decimal place is (are) half-adjusted, rounded-off, or rounded-up (??). If floating point is specified, the value of the least significant digits which cannot be displayed is rounded off.
- [P / $\overline{\text{NP}}$] Switches between print and non print mode. When [P / $\overline{\text{NP}}$] lock key is off, disables all printing except [PF] or [# / P] key. When mode changes from non-print to print, feeds the paper one line.
- [IC +] Selects item count mode.
- [IC $\pm$] IC + Counts up by the [+] or [–] key.
IC $\pm$ Counts up by the [+] key, down by the [–] key.
- [Σ] If an operation is performed by the [=] or [%] key in auto accumulation calculation mode, adds the operation result to the addition / subtraction register and increments the item counter.
- [GT] In grand total mode, adds the total register to the GT register by the [*] key.
- [$\overline{\text{T}}$ / L] When the [$\overline{\text{T}}$ / L] lock key is off, the [P / NP], [Σ], [GT MOD], [IC MOD], [RND], and [DEC] keys are valid. When the [$\overline{\text{T}}$ / L] key is on, the [NP], [Σ], [GT], [IC +], [IC $\pm$], [CUT], [UP], and [0, 1, 2, 3, 4, 6, A, AII] lock keys are valid.
- $\left[\begin{array}{l} \text{SET I} \\ \text{SET II} \end{array} \right]$ When the [SET I / SETII] lock key is on, prints and express the stored tax rate. When the [SET I / SETII] lock key is off, store the expression data to the new tax rate. The result of tax rate is only floating-point, and not concent the decimal-point at this function.
- [FEED] Feed paper.

- [TMR] When the (TMR) lock key is on, auto power-off functions.
(After approx. 6 minutes.)
- [$\overline{10}$ / 12] Selects 10 digits display and printer when the [$\overline{10}$ / 12] lock key is off ; Selects 12 digits display and printer when the [$\overline{10}$ / 12] lock key is on.
- [B / $\overline{BR}$] Prints in single color when selecting B on is specified for the printer ; in two colors, when selecting $\overline{BR}$ off is specified.

4) ON, OFF keys

(1) In touch key mode

- Pressing the [OFF] key enters HOLD mode.
- When entered in HOLD mode by the [OFF] key or the auto power off function, pressing the [ON/C or ON/C, CE] key cancels HOLD mode.
- When HOLD mode is canceled, the memory, TAX, and GT registers are retained. Clears everything else, prints 0.*, then feeds the paper one line.

(2) In lock key mode

- Setting the lock keys to off enters HOLD mode ; to on, cancels HOLD mode.
- When HOLD mode is entered by the auto power off function, turning the lock keys to off, then on, cancels HOLD mode.
- When HOLD mode is canceled, the memory, TAX, and GT registers are retained. Clears everything else, prints 0.*, then feeds the paper one line.

OPERATION EXAMPLE

KEY									TOUCH			PRINT			DISPLAY			
TAB	4/5	IC	Σ	GT	MOD	10/12	B/BR											
F	4/5	OFF	OFF	OFF	CAL	12	BR	POWER ON										
														</				

(Note) : <PF> ... Paper feed
PRINT COLOR ... R: Red
... No mark: Black

KEY								PRINT				DISPLAY			
TAB	4/5	IC	Σ	GT	MOD	10/12	B/BR	TOUCH							
F	4/5	OFF	Σ	OFF	CAL	12	B/BR		0.0618556701	Δ	%	2.0618556701	2.		
									2.0618556701	*					
									<PF>						
								2Δ%	2•	Δ					
								3=	3•	=					
									1•	Δ	*				
									50•	Δ	%				
									<PF>						50.
								3×	3•	×	3.				
								4÷	4•	÷	12.				
								=	4•	=					
									3•	+	3.				
									<PF>						
								5×	5•	×	5.				
								6%	6•	%					
									0•3	+	0.3				
									<PF>						
								+	5•3	+	%			5.3	
									<PF>						
								2÷	2•	÷	2.				
								3%	3•	%					
	66•6666666666	+													
	<PF>				66.6666666666										
2 MU/D	2•	G	M	2.											
3=	3•	%													
	0.0618556701	Δ	*												
	2.0618556701	+													
	<PF>				2.0618556701										
2Δ%	2•	Δ		2.											
3=	3•	=													
	1•	Δ	*												
	50•	+													
	<PF>				50.										
*	122•028522336	*													
	<PF>				122.02852236										
F	4/5	OFF	Σ	GT	CAL	12	B/BR	2+	2•	+	GT	2.			
								3+	3•	+	GT	5.			
								*	5•	G	+				
									<PF>			GT	5.		
								3-	3•	-	R	GT	-3.		
								4-	4•	-	R	GT	-7.		
								5-	5•	-	R	GT	-12.		

KEY								PRINT			DISPLAY	
TAB	4/5	IC	Σ	GT	MOD	10/12	B/BR	TOUCH				
F	4/5	OFF	Σ	OFF	CAL	12	B/BR	*	-12. G +	R	GT	-12.
								GT	<PF>	R	GT	-7.
								GT	-7. G ◇	R		
									-7. G *	R		
									<PF>			-7.
								M I +	-----1-----			
									-7. M +	R	M I	-7.
								5			M I	5.
								M II +	-----2-----			
									5. M +		M II	5.
								M I ◇	-----1-----			
									-7. M ◇	R	M II	-7.
								M I *	-----1-----			
									-7. M *	R		
									<PF>		M II	-7.
								M II ◇	-----2-----			
									5. M ◇		M II	5.
								M II *	-----2-----			
									5. M *			
									<PF>			5.
F	CUT	OFF	OFF	OFF	SET I	12	B/BR	#/P	5. ◇			5.
								2 #/P	#2.....			2.
								#/P	2. ◇			2.
								0÷	0. ÷			0.
								=	0. =			0.
												
									0. *	E		0.
									<PF>			
								C	0. C			
									<PF>			0.
F	CUT	OFF	OFF	OFF	CAL	12	B/BR		-----1-----			
									0. %			
									<PF>			0.
								3				3.
									-----1-----			
									3. %			
									<PF>			0.
								C	0. C			
									<PF>			0.
									-----1-----			
F	CUT	OFF	OFF	OFF	SET I	12	B/BR		3. %			
									<PF>			3.

KEY									PRINT			DISPLAY
TAB	4/5	IC	Σ	GT	MOD	10/12	B/BR	TOUCH				
F	CUT	OFF	OFF	OFF	CAL	12	B/BR		-----2-----			0.
F	CUT	OFF	OFF	OFF	SET II	12	B/BR		0.	%		
								5	<PF>			0.
												5.
F	CUT	OFF	OFF	OFF	CAL	12	B/BR		-----2-----			
									5.	%		
									<PF>			0.
F	CUT	OFF	OFF	OFF	SET II	12	B/BR		-----2-----			
									5.	%		5.
F	CUT	OFF	OFF	OFF	CAL	12	B/BR					0.
								1560				1,560.
								+TAX I	-----1-----			
									1,560.			
									46.8	Δ		
									1,606.8	*		
									<PF>			1,606.8
								1560				1,560.
								+TAX II	-----2-----			
									1,560.			
									78.	Δ		
									1,638.	*		1,638.
									<PF>			
F	CUT	OFF	OFF	OFF	CAL	12	B/BR	+TAX I	-----1-----			
									1,638.	◇		
									49.14	Δ		
									1,687.14	*		1,687.14
									<PF>			
								1560				1,560.
								x	1,560.	x		1,560.
								78900				78,900.
F	4/5	OFF	OFF	OFF	CAL	12	B/BR	+TAX I	-----1-----			
									78,900.	=		
									123,084,000.	◇		
									3,692,520.	Δ		
									126,776,520.	*		
									<PF>			126,776,520.
								=				126,776,520.
								5				126,776,520.
								x	5.	x		5.
								+TAX I				5.
								=	5.	=		

KEY										PRINT			DISPLAY	
TAB	4/5	IC	Σ	GT	MOD	10/12	B/BR	TOUCH						
										25•	*		25.	
									+TAX I	<PF>				
										-----1-----				
										25•	◇			
										0.75	Δ			
										25.75	*		25.75	
										<PF>				
								=					25.75	
								C		0•	C		0.	
										<PF>				
2	CUT	OFF	OFF	OFF	CAL	12	B/BR	1560					1,560.	
								+		1,560.00			1,560.00	
								1100					1,100.	
								+		1,100.00			2,660.00	
								+TAX II		-----2-----				
										2,660.00	◇			
										133.00	Δ			
										2,793.00	*			
										<PF>			2,793.00	
F	CUT	OFF	OFF	OFF	CAL	12	B/BR	+TAX I		-----1-----				
										2,793.00				
										83.79	Δ			
										2,876.79	*			
										<PF>			2,876.79	
								98000000						
								0000					980,000,000,000.	
								+TAX I		-----1-----				
										980,000,000,000•				
										29,400,000,000•	Δ			
														
										1.0094000000	*			
										<PF>		E	1.00940000000	
								C		0•	C		0.	
										<PF>				
								1560					1,560.	
								+/-					-1,560.	
								+TAX I		-----1-----				
										-1,560•		R		
										-46.8	Δ	R		
										-1,606.8	*	R		
										<PF>			-1,606.8	
								1560					1,560.	

KEY								PRINT				DISPLAY
TAB	4/5	IC	Σ	GT	MOD	10/12	B/BR	TOUCH				
								-TAX I	-----1-----			
									1,560•			
									-45•43689321	Δ	R	
									1,514•56310679	*		1,514.56310679
									<PF>			
								-TAX I	-----1-----			
									1,514•56310679	◇		
									-44•11348855	Δ	R	
									1,470•44961824	*		1,470.44961824
									<PF>			
F	CUT	OFF	OFF	OFF	SET I	12	B/BR		-----1-----			
									3•	%		3.
									<PF>			
								C				0.
F	CUT	OFF	OFF	OFF	CAL	12	B/BR		-----1-----			
									0•	%		0.
									<PF>			
F	CUT	OFF	OFF	OFF	SET I	12	B/BR		-----1-----			
									0•	%		
									<PF>			0.
								1234				1234.
F	CUT	OFF	OFF	OFF	CAL	12	B/BR		-----1-----			
									1,234•	%		0.
									<PF>			
F	CUT	OFF	OFF	OFF	SET II	12	B/BR		-----2-----			
									5•	%		
									<PF>			5.
								C				0.
F	CUT	OFF	OFF	OFF	CAL	12	B/BR		-----2-----			
									0•	%		
									<PF>			0.
								98000000				
								0000				
								+TAX I	-----1-----			
F	CUT	OFF	OFF	OFF	CAL	12	B/BR		980,000,000,000•			
												
									0•	*		
									<PF>		E	0.
								C		0•	C	
									<PF>			0.
								2				2.
								x		2•	x	2.

KEY									PRINT				DISPLAY	
TAB	4/5	IC	Σ	GT	MOD	10/12	B/BR	TOUCH						
A	CUT	OFF	OFF	OFF	CAL	12	B/BR	3					3.	
								x		3.	x	6.		
								EXC				3.		
								x		6.	x	18.		
								EXC				6.		
								x		18.	x	108.		
								EXC				18.		
								x		108.	x	1,944.		
								=		108.	=			
										209,952.	*	209,952.		
								123				123.		
								+		1.23	+	1.23		
								456				456.		
								+		4.56	+	5.79		
A II	CUT	OFF	OFF	OFF	CAL	12	B/BR	◇		5.79	◇	5.79		
								*		5.79	*	5.79		
								789				789.		
								x		789.	x	789.		
								100				100.		
								=		1.00	=			
										789.00	*			
										<PF>		789.00		
								123				123.		
								+		123.00	+	123.00		
								456				456.		
								+		456.00	+	579.00		
								*		579.00		579.00		

MAXIMUM RATINGS ($V_{SS} = 0V$)

PARAMETER	SYMBOL	VALUE	UNIT
Supply Voltage 1	V_{DD}	$-0.3 \sim 6$	V
Supply Voltage (LCD Drive)	V_{LC}	$-0.3 \sim V_{DD} + 0.3$	V
Input Voltage	V_{IN}	$-0.3 \sim V_{DD} + 0.3$	V
Output Voltage	V_{OUT}	$-0.3 \sim V_{DD} + 0.3$	V
Output Current	I_{OUT}	3.2	mA
Power Dissipation	P_D	600	mW
Soldering Temperature	T_{sld}	260 (10s)	°C
Storage Temperature	T_{stg}	$-55 \sim 125$	°C
Operating Temperature	T_{opr}	$0 \sim 40$	°C

ELECTRICAL CHARACTERISTICSRecommended operating conditions ($V_{SS} = 0V$, $T_{opr} = 0 \sim 40^\circ C$)

PARAMETER	SYMBOL	TEST CIR- CUIT	CONDITION	MIN	MAX	UNIT
Operating Temperature	T_{opr}	—	—	0	40	°C
Supply Voltage	V_{DD}	—	NORMAL	4.5	5.5	V
		—	SLOW			
		—	HOLD	2.0		
High-Level Input Voltage (Non-Schmitt Circuit)	V_{IH1}	—	$V_{DD} \geq 4.5V$	$V_{DD} \times 0.7$	V_{DD}	
High-Level Input Voltage (Schmitt Circuit)	V_{IH2}			$V_{DD} \times 0.75$	V_{DD}	
High-Level Input Voltage	V_{IH3}	—	$V_{DD} < 4.5V$	$V_{DD} \times 0.9$	V_{DD}	
Low-Level Input Voltage (Non-Schmitt Circuit)	V_{IL1}	—	$V_{DD} \geq 4.5V$	0	$V_{DD} \times 0.3$	
Low-Level Input Voltage (Schmitt Circuit)	V_{IL2}			0	$V_{DD} \times 0.25$	
Low-Level Input Voltage	V_{IL3}	—	$V_{DD} < 4.5V$	0	$V_{DD} \times 0.1$	

DC electrical characteristics ($V_{SS} = 0V$, $V_{DD} = 4.5 \sim 5.5V$, $T_{opr} = 0 \sim 40^\circ C$)

PARAMETER	SYMBOL	TEST CIR- CUIT	TERMINAL	CONDITION	MIN	TYP.	MAX	UNIT
Hysteresis Voltage (Schmitt Circuit)	V _{HS}	—	Hysteresis Input	—	—	0.7	—	V
Input Current	I _{IN1}	—	KO port, TEST, RESET, HOLD	V _{DD} = 5.5V V _{IN} = 5.5 / 0V	—	—	± 2	μA
	I _{IN2}	—	Open Drain R port, P port					
Input Resistance	R _{IN1}	—	KO port TEST with Input Resistor	V _{DD} = 5.5V V _{IN} = 5.5 / 0V	30	70	150	kΩ
	R _{IN2}	—	RESET, HOLD		100	220	450	
Output Leakage Current	I _{LO1}	—	Sink Open Drain R port	V _{DD} = 5.5V V _{OUT} = 5.5V	—	—	2	μA
	I _{LO2}	—	Source Open Drain R port, P port	V _{DD} = 5.5V V _{OUT} = − 1.5V	—	—	− 2	
High-Level Output Voltage	V _{OH}	—	Source Open Drain R port, P port	V _{DD} = 5.5V I _{OH} = − 1.6mA	2.4	—	—	V
Low-Level Output Voltage	V _{OL}	—	Sink Open Drain R port	V _{DD} = 5.5V I _{OL} = 1.6mA	—	—	0.4	V
Pull-Down Resistance	R _{OUT}	—	R port, P port	V _{DD} = 5.5V V _{IN} = 5.5V	30	70	150	kΩ
Output Resistance	R _{OS}	—	SEG	V _{DD} = 5V V _{DD} − V _{LC} = 3V	—	—	35	kΩ
	R _{OC}	—	COM		—	—	—	
Output Voltage	V _{O2 / 3}	—	SEG / COM		3.8	4.0	4.2	V
	V _{O1 / 2}				3.3	3.5	3.7	
	V _{O1 / 3}				2.8	3.0	3.2	
Supply Current (Normal)	I _{DD}	—	—	V _{DD} = 5.5V, V _{LC} = V _{SS} f _c = 4MHz	—	3	6	mA
Supply Current (Hold)	I _{DDH}	—	—	V _{DD} = 5.5V	—	0.5	10	μA

(Note 1) Typ. values are guaranteed at $T_{opr} = 25^\circ C$, $V_{DD} = 5V$.

(Note 2) I_{IN1} : excepts a current through a internal Pull up/down Resistor.

(Note 3) R_{OS} , R_{OC} : Shows On-Resistor at level switching.


(Note 4) $V_{O2/3}$: Shows 2/3 Level Output Voltage at which 1/4 or 1/3 duty LCD drive.

(Note 5) $V_{O1/2}$: Shows 1/2 Level Output Voltage at which 1/2 duty or static LCD drive.

(Note 6) $V_{O1/3}$: Shows 1/3 Level Output Voltage at which 1/4 or 1/3 duty LCD drive.

(Note 7) I_{DD} , I_{DDH} : Current consumption at $V_{IN} = 5.3V / 0.2V$
should be under that KO port is open and R port Voltage Level is valid.


OSCILLATION CIRCUIT (V_{SS} = 0V, V_{DD} = 4.5~5.5V, T_{opr} = 0~40°C)

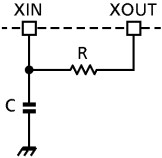RECOMMENDED CIRCUIT	CONDITION	MIN	TYP.	MAX	UNIT
	V _{DD} = 5.0V C = 100pF R = 1kΩ ± 2%	2.4	4.0	5.6	MHz


AC electrical characteristics (V_{SS} = 0V, V_{DD} = 4.5~6.0V, T_{opr} = 0~40°C)

PARAMETER	SYMBOL	TEST CIR- CUIT	CONDITION	MIN	TYP.	MAX	UNIT
Instruction Cycle Time	t _{CY}	—	NORMAL	1.9	—	20	μs
		—	SLOW	235	—	267	
High-Level Clock Pulse Width	t _{WCH}	—	External Clock Operation	80	—	—	ns
Low-Level Clock Pulse Width	t _{WCL}	—					
Shift Data Hold Time	t _{SDH}	—	—	0.5t _{cy} – 300	—	—	ns
High Speed Timer / Counter Input Frequency	f _{HT}	—	—	—	—	f _c	MHz

WAVEFORMS FOR DISPLAY

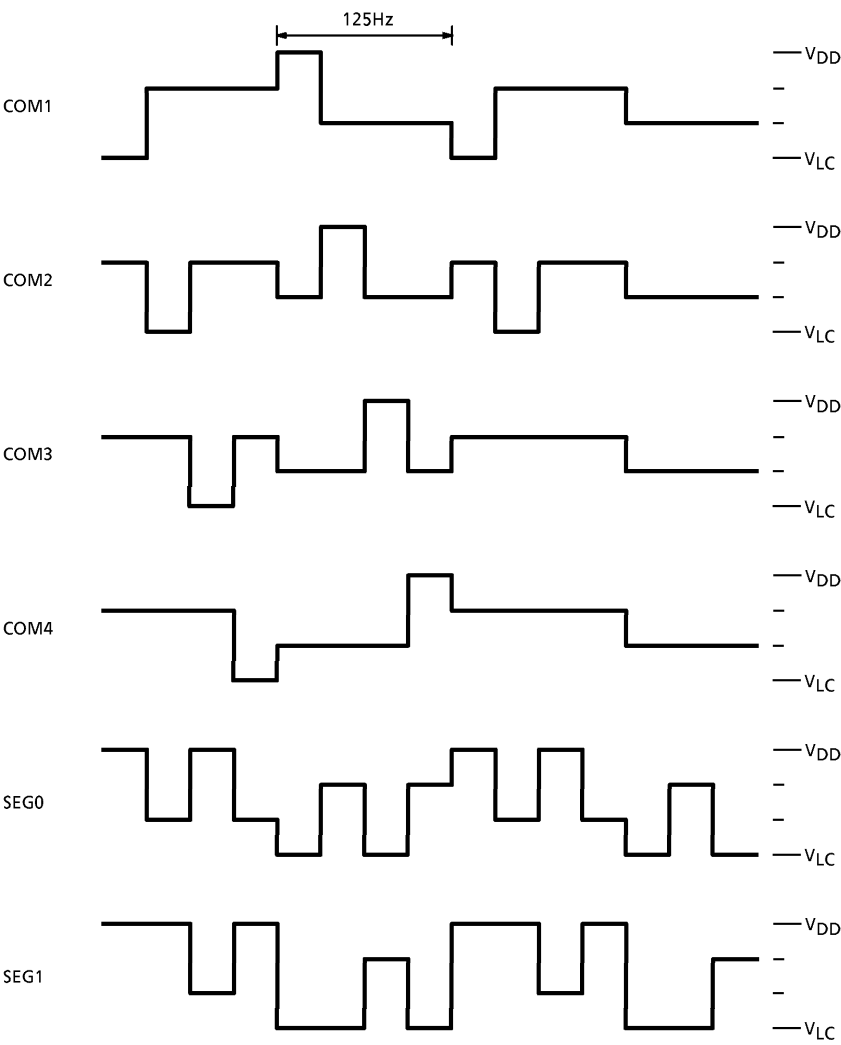

THE PROPOSAL OF OUTER CIRCUIT FOR TAX RATE HOLDING WITH BACK-UP BATTERY.

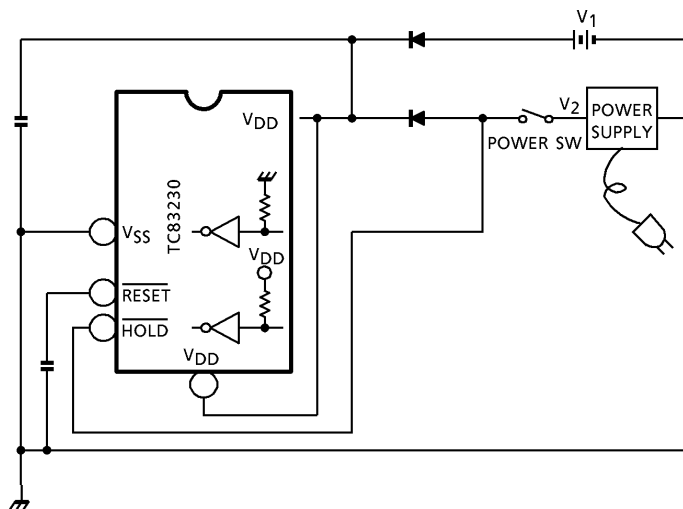

(Note)

$V_1 = +3V$: battery supply

$V_2 = +5V$: DC supply

($\overline{\text{HOLD}}$ pin is pulled down in the LSI, but normally pulled up to V_{DD} .
 $\overline{\text{RESET}}$ pin is pulled up to V_{DD} .)


- ① Setting POWER SW to ON, V_2 is supplied to V_{DD} pin, and also to $\overline{\text{HOLD}}$ pin.
Then calculator operates normally.
- ② Setting POWER SW from ON to OFF, V_1 is supplied to V_{DD} pin and V_{SS} is supplied to $\overline{\text{HOLD}}$ pin.
Under this connection, TAX RATE is held.
- ③ Setting POWER SW to ON, V_2 is supplied to V_{DD} pin, and also to $\overline{\text{HOLD}}$ pin.
Then calculator operates normally with TAX RATE to be held.

<NOTE>

V_1 (battery) should be supplied to the circuit after V_2 (DC) supply, because of prevention from exhaustion of battery and abnormal operation.

PACKAGE DIMENSIONS
QFP80-P-1420-0.80A

Unit : mm

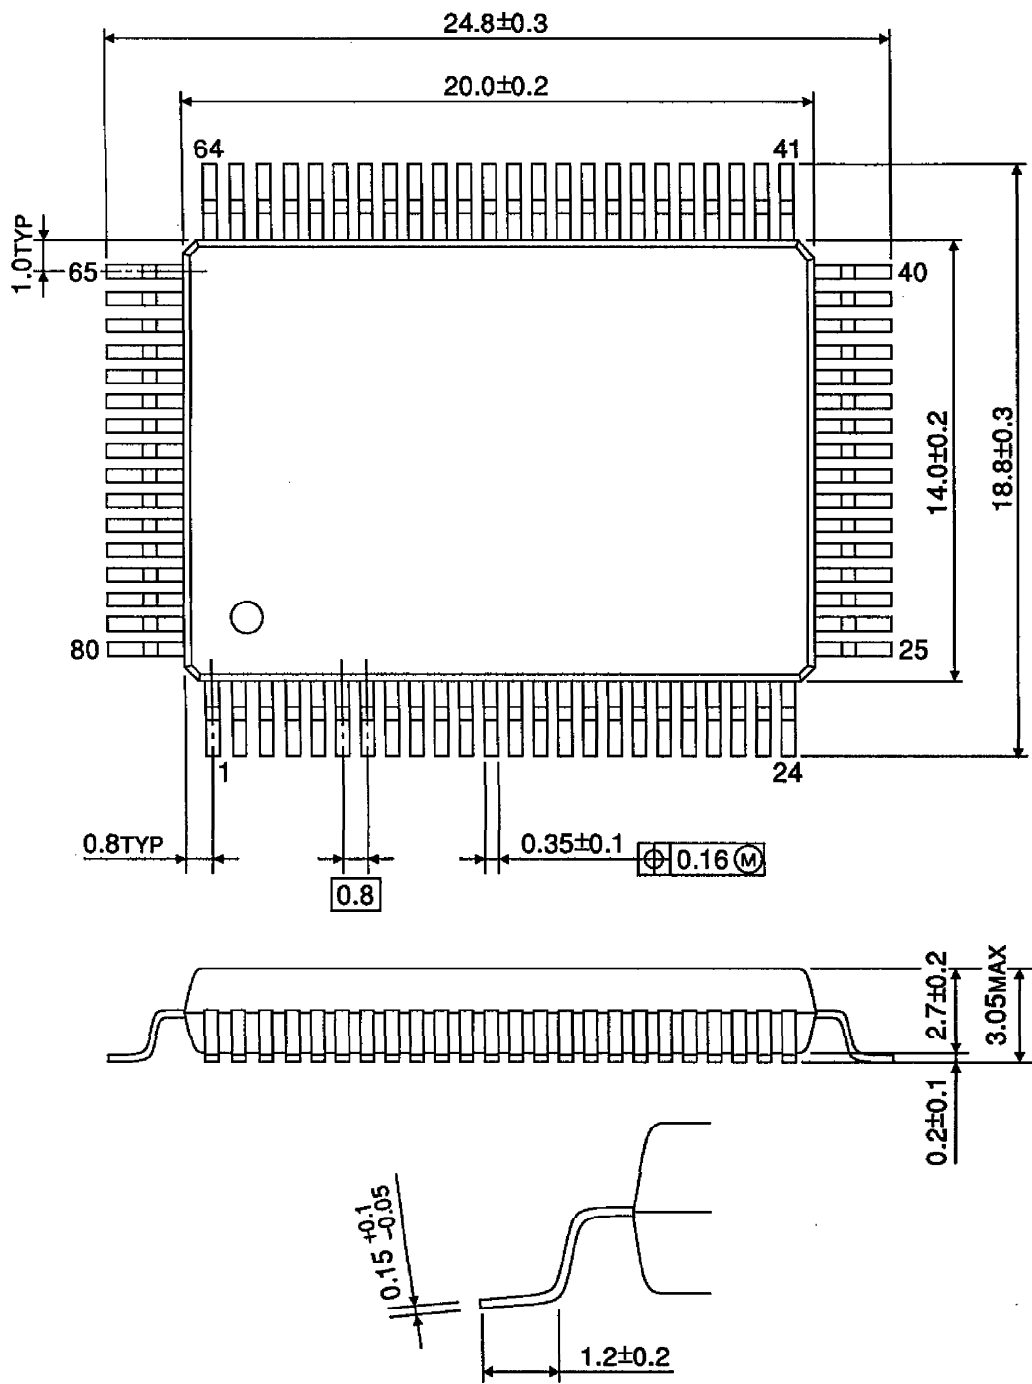

Weight : 1.52g (Typ.)